



## TEST CERTIFICATE

Site Number	<b>840-Emirates Auctions</b>	Transaction Date	<b>20 Jul 2022, 15:39:51</b>
Transaction Number	<b>60637168 (CC10006)</b>	Queue Number	<b>312309</b>



Chassis Number	<b>1GCRKSE32BZ198062</b>
Engine Number	
Vehicle Class	<b>Heavy</b>
Manufacturer	<b>Chevrolet</b>
Model	<b>Silverado</b>
Model Year	<b>2011</b>
Color	<b>White</b>
Mileage	<b>147715 Miles</b>
Fuel Type	<b>Petrol</b>
No. Of Cylinders	<b>8</b>
Specification	<b>USA Imported</b>

DEFECT	REMARKS	
<b>01 Transmission Condition</b>		<b>الجير</b>
01.A Road Test	NOT CHECK	فحص علي الطريق
01.B Visual Gear Box Condition	REFITTED	حالة الجير النظري
<b>02 Lights</b>		<b>الاضاءة</b>
02.A Warning Light	WARNING LIGHT ON IN DISPLAY	ضوء تحذير
02.B Tail Light	RIGHT SIDE CRACKED	الانارة
<b>03 Interior Condition</b>		<b>الحاله الداخليه</b>
03.A Power Window Switch	REAR RIGHT SIDE NOT WORKING	مفتاح النافذه
03.B AC Condition		المكيف
03.C Dash Board	CRACKED	لوحة القيادة
<b>04 Tires and Rims Condition</b>		<b>الاطارات</b>
04.A Rear Tyre	BOTH SIDE 2021	الاطار الخلفي
04.B Front Tyre	BOTH SIDE 2021	الاطار الامامي
<b>05 Steering Condition</b>		<b>المقود</b>
05.A Axel	LEFT SIDE BOOT CUT	اكسلات

DEFECT	REMARKS	
05.B Steering Oil	SIGN OF LEAK	زيت المقود
05.C Tie Rod End	BOOT CUT	مؤخرة الرودادات
<b>06 Body</b>		<b>جسم المركبة</b>
06.A Sign of front accident		وجود مؤشر لحادث في المقدمة
06.B Other	FRONT FENDER FRAME, RADITOR SUPPORT REPAIRED	اخرى
06.C Bumper	FRONT BUMPER FRAME MISSING	دعامية
06.D Rusty	UNDER BODY PARTS, SUSPENSION ,CHASSIS FRAME GETTING RUSTY	صدأ
06.E Paint	BODY TOTALY REPAINTED & REPAIRED,MINOR DENT,SCRATCHES	الصبغ
<b>07 Engine Condition</b>		<b>المحرك</b>
07.A Visual Engine Condition	REFITTED, MISFIRING	حالة المحرك النظرى
07.B Smoke	WHITE SMOKE	دخان
<b>08 Chassis Condition</b>		<b>الشاسي</b>
08.A Chassis	FRONT BOTH SIDE CHASSIS END DENT & CHASSIS FRAME COMPLETELY PORTION RUST PROOFED, GETTING RUSTY	الشاسيه

- The inspection report is valid and shows the vehicle's condition at the time of the inspection only. Car Check doesn't guarantee the vehicle's condition as soon as it leaves the inspection station, and from then on, the inspection is considered invalid.
- Car Check is not responsible for hidden defects of the vehicle, and according to this certificate, Car Check does not guarantee the vehicle's fitness for registration.



- شهادة الفحص سارية وتظهر حالة المركبة وقت الفحص فقط، ولا تضمن كار تشيك حالة المركبة بمجرد خروجها من محطة الفحص، ويعتبر الفحص في هذه الحالة غير ساري.
- كار تشيك غير مسؤولة عن العيوب الخفية في المركبة، كما لا تضمن بموجب هذه الشهادة صلاحية المركبة للتسجيل من عدمه.

# Test Certificate



Vehicle  
Registration



X FAILED

Possession Certificate :	64764202
Chassis No :	1GCRKSE32BZ198062
Vehicle Make :	CHEVROLET
Vehicle Model :	SILVERADO
Vehicle Class :	Light Vehicle
Body Type :	PICK-UP
Fuel :	Benzene
Color :	White
Drive Direction :	--
Dimensions : (H x W x L)	-- x -- x --
Current Odometer :	237725 Kms.
Origin : United States	Model Year : 2011
Gear Type : Automatic	Engine Size : 4 CC
Engine No : NIL	Horse 315
Axles No : 2	Power :
No Of 4	Cylinders : 8
Doors :	No Of Seats : 5
G. V. W. : 2800 Kgs.	Empty 2200 Kgs.
	Weight :

Certificate Number :	5-TAS-2022-17297906		
Inspection Date :	28-07-2022		
Certificate Print Date :	28-07-2022		
Services :	Registration Test		
Vehicle Testing Partner :	Tasjeel		
Vehicle Testing Center :	Tasjeel Warsan		
Total Time Taken :	6 min 45 sec		
Appointment Ref Number :	--		
Start Time :	18:12	End Time :	18:19
Lane :	05	Token No. :	280
Attempt :	1	Prints No. :	1

## Parameter Readings

Service brake imbalance on front axle	Service brake imbalance on rear axle	Parking brake imbalance between LHS and RHS	Vehicle on Petrol CO Reading
13 %	55 %	69 %	0.12 %

## Vehicle on Petrol HC Reading

1196 PPM VOL

## Inspection Findings

Defects	Issue	Severity
Vehicle on Petrol HC Reading	HC reading more than 800ppm	Major
Vehicle on Petrol HC Reading	HC reading more than 800ppm	Major
Service brake imbalance on rear axle	More than 30% imbalance between LHS and RHS	Major
Parking brake imbalance between LHS and RHS	More than 60% imbalance between LHS and	Major
Engine	Misfiring	Major
Engine	Excessive oil smoke	Major
White smoke		

Inspection Remarks: REAR DOOR PILLAR AND RUNNING BOARD REPAIRED

## Payment Details

Inspection Performed by	Payment Method	Transaction Number	Service Fees
33409	VTP Credit Account	17297906	AED 170 Collected on 28/07/2022
Parking Slot No	Service Name	Attempt	Received by
--	Registration Test	1	Omar Abdulla Ebrahim Hassa Mualemi

This is to acknowledge the receipt of AED 170 (in words: One Hundred and Seventy Dirhams Only.), towards the above service.

Information in this certificate regarding the annual consumption rate of the vehicle is based on estimated calculations.

تستخدم هذه الشهادة حصرا في العمليات الخاصة بالتسجيل الفنى للمركبة. لا يعتد بهذه الشهادة لأي عمليات أخرى بما في ذلك أغراض البيع أو الشراء خلاف عملية ترخيص المركبة. لا تتحمل الجهة المصدرة أية مسؤولية جراء استعمال هذه الشهادة لغير ما أصدرت من أجله. هذه الشهادة صالحة لإجراء معاملة واحدة فقط خلال 30 يوم من تاريخ الفحص

This certificate is used exclusively in the technical licensing process for vehicle. This certificate should not be valid for any process including selling or buying purposes other than vehicle licensing process. The issuing entity shall not bear any liability for using this certificate for any purposes other than those it was issued for. This certificate is valid for one transaction only for 30 days from the date of inspection.

