



## TEST CERTIFICATE

Site Number	<b>840-Emirates Auctions</b>	Transaction Date	<b>10 Mar 2023, 12:48:00</b>
Transaction Number	<b>95261328 (CC10009)</b>	Queue Number	<b>686478</b>



Chassis Number	<b>WDB1400571A324322</b>
Engine Number	
Vehicle Class	<b>Car</b>
Manufacturer	<b>Mercedes</b>
Model	<b>SL 600</b>
Model Year	<b>1996</b>
Color	<b>Silver</b>
Mileage	<b>48352 Km</b>
Fuel Type	<b>Petrol</b>
No. Of Cylinders	<b>12</b>
Specification	<b>Imported</b>

DEFECT	REMARKS	
<b>01 Seats Condition</b>		<b>المقاعد</b>
01.A Seat Condition	FRONT RIGHT SIDE ADJUSTMENT NOT WORKING	حالة المقاعد
<b>02 Tires and Rims Condition</b>		<b>الاطارات</b>
02.A Rear Tyre	BOTH SIDE 2022	الاطار الخلفي
02.B Front Tyre	BOTH SIDE 2022	الاطار الامامي
<b>03 Body</b>		<b>جسم المركبة</b>
03.A Rusty	UNDER BODY PARTS GETTING RUSTY ( REPAINTED )	صدأ
03.B Paint	BODY REPAINTED PORTION REPAIRED MINOR DENT SCRATCHES	الصبغ
03.C Fenders	REFITTED	مدكار
03.D Bonnet	REFITTED	غطاء المحرك
03.E Trunk	REFITTED	صندوق
<b>04 Interior Condition</b>		<b>الحاله الداخليه</b>
04.A Power Window Switch	REAR BOTH SIDE NOT WORKING	مفتاح النافذه
04.B Steering Wheel and control buttons	ADJUSTMENT NOT WORKING	عجلة القيادة وازرار التحكم
04.C Sunroof	CURTAIN PORTION LOOSE	فتحت سقف

DEFECT	REMARKS	
04.D AC Condition	NOT WORKING ( SWITCH PANEL NOT WORKING )	المكيف
04.E Mirror	SIDE VIEW MIRROR NOT WORKING PROPERLY	المرآيا
<b>05 Transmission Condition</b>		<b>الجير</b>
05.A Road Test	NOT CHECK	فحص علي الطريق
05.B Visual Gear Box Condition	JERKING, OIL WET	حالة الجير النظرى
<b>06 Engine Cooling System</b>		<b>نظام تبريد المحرك</b>
06.A Radiator Condition	WATER LEAK	حالة المبرد
<b>07 Steering Condition</b>		<b>المقود</b>
07.A Tie Rod End	BOOT CUT	مؤخرة الرودادات
07.B Other	STABILIZER LINK BUSH CRACK	اخرى
<b>08 Chassis Condition</b>		<b>الشاصي</b>
08.A Chassis	FRONT RIGHT SIDE CHASSIS END MINOR BEND	الشاسيه
<b>09 Suspension System</b>		<b>ممتص الصدمات</b>
09.A Arms	LOWER ARM BUSHES CRACKED	ازرع
09.B Ball Joint	BOOT CUT	مفصل كروي
09.C Suspension Subframe	MOUNT BRACKET BEND	
<b>10 Engine Condition</b>		<b>المحرك</b>
10.A Visual Engine Condition	OIL LEAK , PARTS REFITTE D	حالة المحرك النظرى
<b>11 Brake Condition</b>		<b>الفرامل</b>
11.A Caliber Brake	FRONT BOTH SIDE REWALDED , MODIFIED	جهاز الفرامل
<b>12 Exhaust System</b>		<b>نظام العادم</b>
12.A Other	PIPE CUT REWELDED	اخرى

- The inspection report is valid and shows the vehicle's condition at the time of the inspection only. Car Check doesn't guarantee the vehicle's condition as soon as it leaves the inspection station, and from then on, the inspection is considered invalid.
- Car Check is not responsible for hidden defects of the vehicle, and according to this certificate, Car Check does not guarantee the vehicle's fitness for registration.



- شهادة الفحص سارية وتظهر حالة المركبة وقت الفحص فقط، ولا تضمن كار تشيك حالة المركبة بمجرد خروجها من محطة الفحص، ويعتبر الفحص فى هذه الحالة غير ساري.
- كار تشيك غير مسؤولة عن العيوب الخفية في المركبة، كما لا تضمن بموجب هذه الشهادة صلاحية المركبة للتسجيل من عدمه.

# Test Certificate



Vehicle  
Registration



X FAILED

Change possession :	66526361
Chassis No :	WDB1400571A324322
Vehicle Make :	MERCEDES
Vehicle Model :	SL600
Vehicle Class :	Light Vehicle
Body Type :	SALOON
Fuel :	Benzene
Color :	Silver alloy
Drive Direction :	--
Dimensions : (H x W x L)	-- x -- x --
Current Odometer :	48352 Kms.
Origin : Germany	Model Year : 1996
Gear Type : Automatic	Engine Size : 4700 CC
Engine No : NIL	Horse --
Axles No : 2	Power :
No Of 4	Cylinders : 12
Doors :	No Of Seats : 5
G. V. W. : 1560 Kgs.	Empty 1000 Kgs.
	Weight :

Certificate Number :	5-TAS-2023-19011406		
Inspection Date :	13-03-2023		
Certificate Print Date :	13-03-2023		
Services :	Registration Test		
Vehicle Testing Partner :	Tasjeel		
Vehicle Testing Center :	Tasjeel Al Aweer		
Total Time Taken :	20 min 10 sec		
Appointment Ref Number :	--		
Start Time :	11:25	End Time :	11:45
Lane :	03	Token No. :	152
Attempt :	1	Prints No. :	1

## Parameter Readings

Service brake imbalance on front axle	Service brake imbalance on rear axle	Parking brake imbalance between LHS and RHS	Vehicle on Petrol CO Reading
2 %	5 %	9 %	0.44 %
Vehicle on Petrol HC Reading			
247 PPM VOL			

## Inspection Findings

Defects	Issue	Severity
Caliper/Cylinder front both side brake caliper bracket modified /fix original	Others (Major)	Major
Suspension kit change front both side lower arm suspension bush crack	Others (Major)	Major

Discrepancies	Old Value	New Value	Verified
Engine Size Discrepancy in Engine Size	4700	6000	

## Payment Details

Inspection Performed by	Payment Method	Transaction Number	Service Fees
6831	VTP Credit Account	19011406	AED 170 Collected on 13/03/2023
Parking Slot No	Service Name	Attempt	Received by
--	Registration Test	1	Bajurdeen Abdul Gafoor

- 1 This is to acknowledge the receipt of AED 170 (in words: One Hundred and Seventy Dirhams Only.), towards the above service.  
2 Information in this certificate regarding the annual consumption rate of the vehicle is based on estimated calculations.

تستخدم هذه الشهادة حصرا في العمليات الخاصة بالترخيص الفني للمركبة. لا يعتمد بهذه الشهادة لأي عمليات أخرى بما في ذلك أعراض البيع أو الشراء خلاف عملية ترخيص المركبة. لا تتحمل الجهة المصدرة أية مسؤولية جراء استعمال هذه الشهادة لغير ما أصدرت من أجله. هذه الشهادة صالحة لإجراء معاملة واحدة فقط خلال 30 يوم من تاريخ الفحص.

This certificate is used exclusively in the technical licensing process for vehicle. This certificate should not be valid for any process including selling or buying purposes other than vehicle licensing process. The issuing entity shall not bear any liability for using this certificate for any purposes other than those it was issued for. This certificate is valid for one transaction only for 30 days from the date of inspection.

