

TEST CERTIFICATE

18 Sep 2021, 14:18:55

JTHBN30F510024102

Site Number 840-Emirates Auctions Transaction Date

Transaction Number 93076858 (CC10006) Queue Number 312309



Engine Number

Vehicle Class Car

Manufacturer Lexus

Model LS 430

Model Year 2001

Color Grey

Mileage 474964

Chassis Number

DEFECT	REMARKS	
O1 Body		جسم المركبة
01.A Fenders	PORTION REPAIRED & REPAINTED	مدكار
01.B Paint	BODY TOTALY PORTION REPAIRED , REPAINTED, FADED EXCEPT ROOF & DENTS ,SCRATCHES ON BODY	الصبغ
01.C Doors	PORTION REPAIRED, REPAINTED & REAR TRUNK FADED	أبواب
01.D Rusty	UNDER BODY PARTS GETTING , FLOORING RUSTY	صدأ
01.E Bumper	REPAIRED, REPAINTED	دعامية
01.F Bonnet	REPAINTED	غطاء المحرك
01.G Other	FRONT FENDER FRAME, BUMPER FRAME, RADITOR SUPPORT, BULK HEAD REPAIRED	اخري
02 Chassis Condition		الشاصي
02.A Chassis	FRONT RIGHT SIDE REPAIRED	الشاسيه
03 Engine Condition		المحرك
03.A Other	OIL LEAK & MISSFIRING	اخري
03.B Mount	BUSHES CRACKED	كرسي
04 Seats Condition		المقاعد
04.A Other	OK	اخري
05 Transmission Condition		الجير
05.A Gear Box	MINOR LEAK	الجير
05.B Gear Box Mount	BUSHES CRACKED	كرىسي الجير

DEFECT	REMARKS	
05.C Propeller Shaft	POPELLAR SHAFT RUBBER CRACKED	ناقل الحركة
06 Wipers and Arms		المساحات
06.A Other	WORN OUT	اخري
07 Lights		الاضاءة
07.A Head Light	ОК	الاضاءة الرئيسية
07.B Other	ОК	اخري
08 Tires and Rims Condition		الاطارات
08.A Front Tyre	BOTH SIDE 2019	الاطار الامامي
08.B Rear Tyre	BOTH SIDE 2019	الاطار الخلفي
09 Brake Condition		الفرامل
09.A Caliber Brake	GETTING RUSTY	جهاز الفرامل
10 Suspension System		ممتص الصدمات
10.A Arms	FRONT BOTH SIDE LOWER ARMS BUSHES DRY CRACKED	ازرع
11 Interior Condition		الاجزاء الداخلية
11.A Other	SEAT COVER DAMAGED & GLASS WINDOW NOT WORKING, BUTTON DAMAGED	اخري
11.B Mirror	ОК	المرايا
11.C AC Condition	A/C NOT COOLING	المكيف

- The inspection report is valid and shows the vehicle's condition at the time of the inspection only. Car Check doesn't guarantee the vehicle's condition as soon as it leaves the inspection station, and from then on, the inspection is considered invalid.
- Car Check is not responsible for hidden defects of the vehicle, and according to this certificate,
 Car Check does not guarantee the vehicle's fitness for registration.



- شهادة الفحص سارية وتظهر حالة المركبة وقت الفحص فقط، ولا تضمن كار تشيك حالة المركبة بمجرد خروجها من محطة الفحص، ويعتبر الفحص فى هذه الحالة غير ساري.
- كار تشيك غير مسؤولة عن العيوب الخفية في المركبة، كما لا تضمن بموجب هذه الشهادة صلاحية المركبة للتسجيل من عدمه.

Test Certificate











Plate Details: JTHBN30F510024102 Chassis No: Vehicle Make: LEXUS Vehicle Model: LS 430 Vehicle Class: Light Vehicle **Body Type:** SALOON Fuel: Benzene Color: Silver **Drive Direction: Dimensions**: (H x W x L) --x--x--**Current Odometer:** 764380 Kms. Origin: Japan Model Year: 2001 4300 CC Gear Type: --Engine Size: Engine No: Horse Power: 286 NIL Axles No: Cylinders: No Of Doors: 4 No Of Seats:

Certificate Number :	5-TAS-2021-15064561		
Inspection Date :	21-09-2021		
Certificate Print Date:	21-09-2021		
Services :	Registration Test		
Vehicle Testing Partner:	Tasjeel		
Vehicle Testing Center: Tasjeel Al Aweer			
Total Time Taken: 14 min 48 sec			
Appointment Ref Number	:		
Start Time: 12:40	End Time: 12:55		
Lane: 02	Token No.: 144		
Attempt: 1	Prints No: 1		

Parameter Readings

2000 Kgs.

G. V. W. :

Service brake imbalance on front axle

0%

Service brake imbalance on rear axle 2 %

Empty Weight: 1830 Kgs.

Parking brake imbalance between LHS and RHS 8% Vehicle on Petrol CO Reading 0.69 %

Vehicle on Petrol HC Reading 2735 PPM VOL

Inspection Findings

Defects	Issue	Severity
Steering Boots and Ball Joints REPAIR STEERING BOOT LEAK	Worn-out or missing boot(s) (Major)	Major
Tinted REMOVE ALL FADED TINT	Dark	Major
Stop lamps REPAIR STOP LAMP	Defective	Major
Chassis REMOVE FRONT AND REAR FENDER AND UNDER COVER FOR R	Others (Major) ECHECK / CLEAN FRONT BOTH SII	Major DE CHASSIS FOR RECHECK
Gear/Differential REPAIR	Oil leaking continuously	Major
Warning triangle KEEP	Missing	Major
Vehicle on Petrol HC Reading	HC reading more than 800ppm	Major
Vehicle on Petrol HC Reading	HC reading more than 800ppm	Major
Park and Tail lamps REPAIR REAR PARK LIGHT	Defective	Major
Shock Absorber CHANGE REAR LEFT SHOCK	Major leak	Major
Arm, mounting, bushes CHANGE REAR LOWER AND UPPER CONTROL ARM BUSHES	Cracked, broken, bend arm	Major
Paint REPAINT FADED AREA	Totally faded	Major
Battery FIX CLAMP	Unsecure	Major

Inspection Remarks: BULK HEAD, FENDER FRAME, RAD SUPPORT REPAIRED, UNDER NEATH MUD

Payment Details

Inspection Performed by 33695

Payment Method
Cash

Transaction Number 15064561

Service Fees
AED 170 Collected on 21/09/2021

 Parking Slot No
 Service Name
 Attempt
 Received by

 - Registration Test
 1
 Sittu Paloth Sreesan Paloth

1 This is to acknowledge the receipt of AED 170 (in words: One Hundred and Seventy Dirhams Only.), towards the above service.

Information in this certificate regarding the annual consumption rate of the vehicle is based on estimated calculations.
TA
تستخدم هذه الشهادة حصرا في العمليات الخاصة بالترخيص الفني للمركبة. لا يعتد بهذه الشهادة لأي عمليات أخرى بما في ذلك أغراض البيع أو الشراء خلاف عملية
ترخيص المركبة. لا تتحمل الجهة المصدرة أية مسؤولية جراء استعمال هذه الشهادة لغير ما أصدرت من أجله. هذه الشهادة صالحة لإجراء معاملة واحدة فقط خلال
30.



This certificate is used exclusively in the technical licensing process for vehicle. This certificate should not be valid for any process including selling or buying purposes other than vehicle licensing process. The issuing entity shall not bear any liability for using this certificate for any purposes other than those it was issued for. This certificate is valid for one transaction only for 30 days from the date of inspection.