



## TEST CERTIFICATE

Site Number	<b>840-Emirates Auctions</b>	Transaction Date	<b>04 Jan 2022, 18:13:27</b>
Transaction Number	<b>47825649 (CC10006)</b>	Queue Number	<b>312309</b>



Chassis Number	<b>5TFEY5F11AX095818</b>
Engine Number	
Vehicle Class	<b>Heavy</b>
Manufacturer	<b>Toyota</b>
Model	<b>Tundra</b>
Model Year	<b>2010</b>
Color	<b>Brown</b>
Mileage	<b>185298 Miles</b>
Fuel Type	<b>Petrol</b>
No. Of Cylinders	<b>8</b>
Specification	<b>USA Imported</b>

DEFECT	REMARKS	
<b>01 Lights</b>		<b>الاضاءة</b>
01.A Warning Light	WARNING LIGHT ON IN DISPLAY	ضوء تحذير
01.B Fog light	LEFT SIDE NOT WORKING&LENS FADED	كشاف الضباب
01.C Indicator & Hazard light	FRONT BOTH SIDE INDICATOR NOT WORKING	الاشارات
01.D Tail Light	REAR LEFT SIDE BROKEN	الانارة
<b>02 Interior Condition</b>		<b>الحاله الداخليه</b>
02.A Roof Ceiling	LOOSE	بطانه السقف
02.B AC Condition	OK	المكيف
02.C Power Window Switch	FRONT RIGHT SIDE MAIN SWITCH NOT WORKING & REAR RIGHTSIDE OWN SWITCH NOT WORKING	مفتاح النافذه
02.D Steering Wheel and control buttons	WORN OUT	عجلة القيادة وازرار التحكم
02.E Mirror	CENTER MIRROR LOOSE	المرايا
<b>03 Body</b>		<b>جسم المركبة</b>
03.A Fenders	FRONT RIGHT SIDE & REAR CARRIOR BOX , REPAINTED,PORTION REPAIRED	مدكار
03.B Doors	FRONT & REAR BOTH SIDE REPAINTED,PORTION REPAIRED	أبواب
03.C Pillars	BOTH SIDE D/PILLAR OUTER REPAIRED,REPAINTED	القوائم

DEFECT	REMARKS	
03.D Paint	BODY PORTION REPAINTED,PORTION REPAIRED,MINOR DENT,SCRATCHES,	الصبغ
03.E Bumper	REAR BUMPER FRAME BRAKE	دعامية
03.F Sign of side accident		وجود مؤشر لحادث في الجانب
03.G Trunk	REAR CARRIOR BOX DOOR REPAIRED,REPAITED,UPPER COVER LOOSE	صندوق
03.H Bonnet	SHOCK STAND NOT WORKING	غطاء المحرك
<b>04 Brake Condition</b>		<b>الفرامل</b>
04.A Hand Brake	WEAK	فرامل اليد
<b>05 Suspension System</b>		<b>ممتص الصدمات</b>
05.A Leaf Spring	LEAF SPRING BUSHES WORN OUT& SPRING MISALIGN	
05.B Arms	FRONT LOWER ARM BUSHES CRACKED	ازرع
<b>06 Transmission Condition</b>		<b>الجير</b>
06.A Gear Box Mount	MOUNT CRACKED	كرسي الجير
06.B Gear Box	OIL LEAK , REFITTED	الجير
06.C Road Test	NOT CHECK	فحص علي الطريق
06.D Propeller Shaft	PROPELLAR SHAFT CENTER RUBBER WORN OUT	ناقل الحركة
<b>07 Engine Condition</b>		<b>المحرك</b>
07.A Engine Condition	OIL LEAK,REFITTED	حالة المحرك
<b>08 Steering Condition</b>		<b>المقود</b>
08.A Axel	INNER AXLE BOOT CUT	اكسلات
08.B Tie Rod End	BUSHES CUT	مؤخرة الرودادات
<b>09 Wipers and Arms</b>		<b>المساحات</b>
09.A Wiper Arm &Blade	WORN OUT	ازرع المساحات والشفرات
<b>10 Chassis Condition</b>		<b>الشاصي</b>
10.A Chassis	REAR LEFT SIDE CHASSIS REPAIRED	الشاسيه
<b>11 Seats Condition</b>		<b>المقاعد</b>
11.A Seat Belt	OK	حزام الأمان
11.B Seat Condition	FRONT LEFT SEAT SIDE COVER LOOSE	حالة المقاعد
<b>12 Battery Condition</b>		<b>حالة البطارية</b>
12.A Battery Condition	OK	حالة البطارية
<b>13 Tires and Rims Condition</b>		<b>الاطارات</b>
13.A Front Tyre	BOTH SIDE 2018 MINOR CRACKED	الاطار الامامي
13.B Rear Tyre	BOTH SIDE 2018	الاطار الخلفي
13.C Rims Condition	RIMS HAVE MINOR SCRATCHES & FRONT RIGHT SIDE 1 NUT& BOLT MISSING & REAR LEFT SIDE WHEEL HUB COVER DAMAGED	حالة الجنوط

- The inspection report is valid and shows the vehicle's condition at the time of the inspection only. Car Check doesn't guarantee the vehicle's condition as soon as it leaves the inspection station, and from then on, the inspection is considered invalid.
- Car Check is not responsible for hidden defects of the vehicle, and according to this certificate, Car Check does not guarantee the vehicle's fitness for registration.



- شهادة الفحص سارية وتظهر حالة المركبة وقت الفحص فقط، ولا تضمن كار تشيك حالة المركبة بمجرد خروجها من محطة الفحص، ويعتبر الفحص في هذه الحالة غير ساري.
- كار تشيك غير مسؤولة عن العيوب الخفية في المركبة، كما لا تضمن بموجب هذه الشهادة صلاحية المركبة للتسجيل من عدمه.

# Test Certificate



Vehicle  
Registration



X FAILED

Plate Details :	--
Chassis No :	5TFEY5F11AX095818
Vehicle Make :	TOYOTA
Vehicle Model :	TUNDRA
Vehicle Class :	Light Vehicle
Body Type :	PICK-UP
Fuel :	Benzene
Color :	Brown
Drive Direction :	--
Dimensions : (H x W x L) :	-- x -- x --
Current Odometer :	298211 Kms.
Origin : United States	Model Year : 2010
Gear Type : Automatic	Engine Size : 3500 CC
Engine No : NIL	Horse Power : 381
Axles No : 2	Cylinders : 8
No Of Doors : 4	No Of Seats : 5
G. V. W. : 3175 Kgs.	Empty Weight : 2440 Kgs.

Certificate Number :	5-TAS-2022-15848021
Inspection Date :	09-01-2022
Certificate Print Date :	09-01-2022
Services :	Registration Test
Vehicle Testing Partner :	Tasjeel
Vehicle Testing Center :	Tasjeel Al Aweer
Total Time Taken :	16 min 44 sec
Appointment Ref Number :	--
Start Time : 13:15	End Time : 13:32
Lane : 01	Token No. : 162
Attempt : 1	Prints No : 1

## Parameter Readings

Service brake imbalance on front axle	Service brake imbalance on rear axle	Parking brake imbalance between LHS and RHS	Vehicle on Petrol CO Reading
2 %	2 %	4 %	0 %
Vehicle on Petrol HC Reading			
1 PPM VOL			

## Inspection Findings

Defects	Issue	Severity
Park and Tail lamps REPAIR FRONT RIGHT SIDE PARK LIGHT	Defective	Major
Rear registration plate lamps REPAIR PLATE LIGHT	Bulb busted	Major
Axles CHANGE FRONT BOTH SIDE INNER AXLE BOOT CRACK	Worn-out axle joint, boot (Major)	Major
Park and Tail lamps CHANGE REAR LEFT SIDE TAIL LAMP LENS CRACK	Lens cracked, broken or faded (Major)	Major
Direction-indicator lamps REPAIR FRONT BOTH SIDE	Defective	Major
Springs (leaf/coil) and shackle pin CHANGE REAR BOTH SIDE LIFT SPRING BUSH CRACK	Worn-out bushes	Major
Engine REPAIR ENGINE OIL LEAK	Others (Major)	Major

Inspection Remarks: REAR BUMPER CROSS MEMBER REPAIRED

## Payment Details

Inspection Performed by	Payment Method	Transaction Number	Service Fees
62439	Cash	15848021	AED 170 Collected on 09/01/2022
Parking Slot No	Service Name	Attempt	Received by
--	Registration Test	1	Hussain Basha Akeel

- 1 This is to acknowledge the receipt of AED 170 (in words: One Hundred and Seventy Dirhams Only.), towards the above service.  
2 Information in this certificate regarding the annual consumption rate of the vehicle is based on estimated calculations.

تستخدم هذه الشهادة حصرا في العمليات الخاصة بالتسجيل الفنى للمركبة. لا يعتد بهذه الشهادة لأي عمليات أخرى بما في ذلك أغراض البيع أو الشراء خلاف عملية ترخيص المركبة. لا تتحمل الجهة المصدرة أية مسؤولية جراء استعمال هذه الشهادة لغير ما أصدرت من أجله. هذه الشهادة صالحة لإجراء معاملة واحدة فقط خلال 30 يوم من تاريخ الفحص.

This certificate is used exclusively in the technical licensing process for vehicle. This certificate should not be valid for any process including selling or buying purposes other than vehicle licensing process. The issuing entity shall not bear any liability for using this certificate for any purposes other than those it was issued for. This certificate is valid for one transaction only for 30 days from the date of inspection.

