




TEST CERTIFICATE

Site Number	840-Emirates Auctions	Transaction Date	27 Dec 2021, 18:07:06
Transaction Number	17694478 (CC10006)	Queue Number	312309

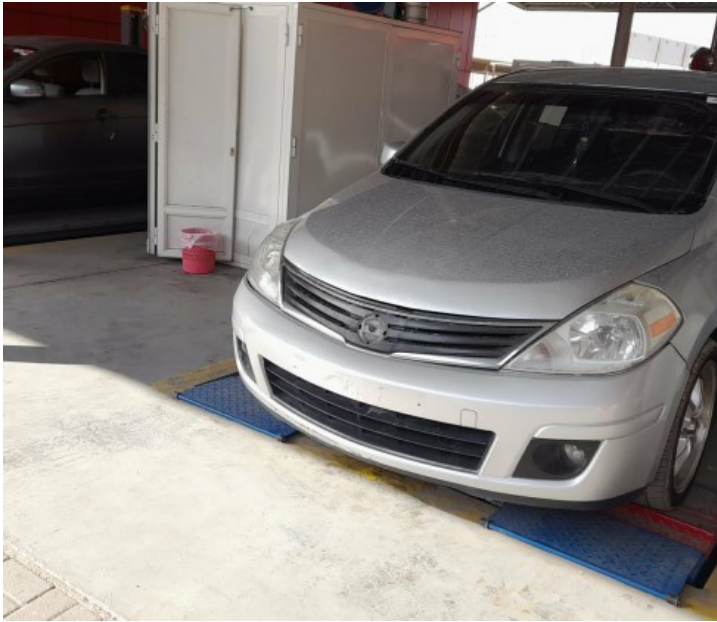

Chassis Number	3N1BC1AP3AL404869
Engine Number	
Vehicle Class	Car
Manufacturer	Nissan
Model	Versa
Model Year	2010
Color	Silver
Mileage	210888 Miles
Fuel Type	Petrol
No. Of Cylinders	4
Specification	USA Imported

DEFECT	REMARKS	
01 Body		جسم المركبة
01.A Fenders	FRONT BOTH SIDE FENDER REPAINTED,REFITTED	مدكار
01.B Bonnet	REPAINTED,PORTION REPAIRED,REFITTED&OPENING HANDLE DAMAGED	غطاء المحرك
01.C Doors	FRONT RIGHT SIDE REPAINTED	أبواب
01.D Paint	BODY PORTION REPAINTED,PORTION REPAIRED,DENT,SCRATCHES	الصبغ
01.E Trunk	TRUNK NOT OPENING	صندوق
01.F Bumper	REPAINTED,MISALIGN	دعامية
01.G Other	FRONT FENDER FRAME ,BULK HEAD,BUMPER FRAME RADIATOR SUPPORT REPAIRED	اخرى
01.H Sign of front accident		وجود مؤشر لحادث في المقدمة
02 Tires and Rims Condition		الاطارات
02.A Front Tyre	BOTH SIDE 2018&RIGHT OUTER CUT	الاطار الامامي
02.B Rear Tyre	BOTH SIDE 2018	الاطار الخلفي
02.C Rims Condition	RIMS HAVE MINOR DENT SCRATCHES	حالة الجنوط
03 Steering Condition		المقود
03.A Other	STEERING WHEEL LOOSE	اخرى

DEFECT	REMARKS	
04 Interior Condition		الحاله الداخليه
04.A Steering Wheel and control buttons	WORN OUT,HORN NOT WORKING	عجلة القيادة وازرار التحكم
04.B AC Condition	OK&FRONT RIGHT SIDE GRILL DAMAGED	المكيف
04.C Dash Board	MINOR CRACKED	لوحة القيادة
04.D Other	GEAR SHIFTING LEVER KNOB WORN OUT	اخرى
04.E Mirror	VIEW MIRROR FADED	المرابيا
05 Suspension System		ممتص الصدمات
05.A Shock Absorber	FRONT BOTH SIDE UPPER SHOCK ABSORBER MOUNT BUSHES CUT	ممتص الصدمات
05.B Arms	FRONT LOWER ARM BUSHES CRACKED	ازرع
06 Lights		الاضاءة
06.A Fog light	LEFT SIDE NOT WORKING	كشاف الضباب
06.B Warning Light	WARNING LIGHT ON IN DISPLAY	ضوء تحذير
06.C Head Light	HEAD LIGHT BRACKET BROKEN	الاضاءة الرئيسية
07 Engine Condition		المحرك
07.A Mount	UPPER ENGINE MOUNT BUSHES CUT	كرسي
07.B Engine Condition	SHAKING,NOISY	حالة المحرك
08 Battery Condition		حالة البطارية
08.A Battery Condition	WEAK	حالة البطارية
08.B Battery bracket	BATTERY BRACKET MISSING	حامل البطارية
09 Seats Condition		المقاعد
09.A Seat Belt	OK	حزام الأمان
09.B Seat Condition	FRONT RIGHT SIDE & REAR SEATS HAVE HOLES	حالة المقاعد
10 Chassis Condition		الشاصي
10.A Chassis	FRONT RIGHT SIDE CHASSIS REPAIRED	الشاسيه
11 Transmission Condition		الجير
11.A Gear Box	OIL LEAK	الجير
11.B Road Test	NOT CHECK	فحص علي الطريق
12 Wipers and Arms		المساحات
12.A Wiper Arm &Blade	WORN OUT	ازرع المساحات والشفرات

- The inspection report is valid and shows the vehicle's condition at the time of the inspection only. Car Check doesn't guarantee the vehicle's



- شهادة الفحص سارية وتظهر حالة المركبة وقت الفحص فقط، ولا تضمن كار تشيك حالة المركبة بمجرد خروجها من محطة الفحص، ويعتبر الفحص في هذه الحالة غير ساري.



- كار تشيك غير مسؤولة عن العيوب الخفية في المركبة، كما لا تضمن بموجب هذه الشهادة صلاحية المركبة للتسجيل من عدمه.

condition as soon as it leaves the inspection station, and from then on, the inspection is considered invalid.

- Car Check is not responsible for hidden defects of the vehicle, and according to this certificate, Car Check does not guarantee the vehicle's fitness for registration.

Test Certificate



Vehicle
Registration



X FAILED

Possession Certificate : 66046045

Chassis No : 3N1BC1AP3AL404869

Vehicle Make : NISSAN

Vehicle Model : VERSA

Vehicle Class : Light Vehicle

Body Type : SALOON

Fuel : Benzene

Color : Silver

Drive Direction : --

Dimensions : (H x W x L) -- x -- x --

Current Odometer : 339392 Kms.

Origin : United States Model Year : 2010

Gear Type : Automatic Engine Size : 1800 CC

Engine No : NIL Horse Power : 122

Axles No : 2 Cylinders : 4

No Of Doors : 4 No Of Seats : 5

G. V. W. : 1500 Kgs. Empty Weight : 1020 Kgs.

Certificate Number : 5-TAS-2022-15805873

Inspection Date : 03-01-2022

Certificate Print Date : 03-01-2022

Services : Registration Test

Vehicle Testing Partner : Tasjeel

Vehicle Testing Center : Tasjeel Al Aweer

Total Time Taken :
17 min 39 sec

Appointment Ref Number : --

Start Time : 10:17

End Time : 10:34

Lane : 01

Token No. : 108

Attempt : 1

Prints No : 1

Parameter Readings

Service brake imbalance on
front axle
7 %

Service brake imbalance on
rear axle
16 %

Parking brake imbalance
between LHS and RHS
35 %

Vehicle on Petrol CO
Reading
0.71 %

Vehicle on Petrol HC
Reading
83 PPM VOL

Inspection Findings

Defects	Issue	Severity
Engine top engine mounting crack	Worn out rubber mountings	Major
Horn repair defective	Defective (Major)	Major
Gear/Differential repair gear box oil leak	Oil leaking continuously	Major
Battery battery over size&bracket missing	Unsecure	Major
Tire change front right side tire side wall cut&ply exposed	Cracked	Major
Steering Box repair steering box oil leak	Continuous or excessive oil leak	Major
Doors and Locks rear tail door not open for recheck compartment	Others (Major)	Major

Inspection Remarks:

FRONT BUMPER FRAME,CRAASH BOX,BULK HEAD,FENDER FRAME,CROSS MEMBER & RIGHT SIDE CHASSIS SLIGHTLY DENT/OLD REPAIRED.MINOR SCRATCHES ON BODY/BUMPER.

Payment Details

Inspection Performed by
8008085
62439

Payment Method
Cash

Transaction Number
15805873

Service Fees
AED 170 Collected on 03/01/2022

Parking Slot No
--

Service Name
Registration Test

Attempt
1

Received by
Hussain Basha Akeel

1 This is to acknowledge the receipt of AED 170 (in words: One Hundred and Seventy Dirhams Only.), towards the above service.

2 Information in this certificate regarding the annual consumption rate of the vehicle is based on estimated calculations.

تستخدم هذه الشهادة حصرا في العمليات الخاصة بالترخيص الفني للمركبة. لا يعتد بهذه الشهادة لأي عمليات أخرى بما في ذلك أغراض البيع أو الشراء خلاف عملية ترخيص المركبة. لا تتحمل الجهة المصدرة أية مسؤولية جراء استعمال هذه الشهادة لغير ما أصدرت من أجله. هذه الشهادة صالحة لإجراء معاملة واحدة فقط خلال 30 يوم من تاريخ الفحص

This certificate is used exclusively in the technical licensing process for vehicle. This certificate should not be valid for any process including



selling or buying purposes other than vehicle licensing process. The issuing entity shall not bear any liability for using this certificate for any purposes other than those it was issued for. This certificate is valid for one transaction only for 30 days from the date of inspection.