



TEST CERTIFICATE

Site Number	840-Emirates Auctions	Transaction Date	07 Jul 2022, 18:04:15
Transaction Number	47412458 (CC10006)	Queue Number	312309



Chassis Number	2GCEK19J981149654
Engine Number	
Vehicle Class	Heavy
Manufacturer	Chevrolet
Model	Silverado
Model Year	2008
Color	Grey
Mileage	56056 Miles
Fuel Type	Petrol
No. Of Cylinders	8
Specification	USA Imported

DEFECT	REMARKS	
01 Chassis Condition		الشاسي
01.A Chassis	LEFT SIDE CHASSIS MIDDLE BEND & REPAIRED	الشاسيه
02 Body		جسم المركبة
02.A Sign of front accident		وجود مؤشر لحادث في المقدمة
02.B Door Handle & Lock	FRONT LEFT SIDE DOOR LOCK DAMAGED, NOT CLOSED	مقابض الأبواب والأقفال
02.C Paint	BODY TOTALLY REPAINTED & PORTION REPAIRED, MINOR DENT, SCRATCHES	الصبغ
02.D Fenders	FRONT FENDER REFITTED	مدكار
02.E Bonnet	REFITTED	غطاء المحرك
02.F Other	FRONT BUMPER FRAME BULK HEAD FENDER FRAME RADIATOR SUPPORT REPAIRED	اخرى
02.G Sign of side accident		وجود مؤشر لحادث في الجانب
03 Interior Condition		الحاله الداخليه
03.A Other	CENTER CONSOLE BOX COVER MISSING	اخرى
03.B Roof Ceiling	LOOSE	بطانه السقف
03.C Dash Board	DAMAGED/ SIDE SWITCH COVERS LOOSE	لوحة القيادة
03.D Door Panel	BOTH SIDE DOOR PANEL COVER LOOSE	لوحة بطانة الباب

DEFECT	REMARKS	
03.E AC Condition	NOT COOLING	المكيف
03.F Power Window Switch	FRONT RIGHT REAR BOTH SIDE NOT WORKING , PANELSLOOSE	مفتاح النافذه
03.G Sun Visor	RIGHT SIDE GLASS COVER MISSING	حاجب الشمس
03.H Steering Wheel and control buttons	WORN OUT & LOWER COVER LOOSE	عجلة القيادة وازرار التحكم
03.I Mirror	LEFT SIDE OUTER COVER PORTION DAMAGED	المرابا
04 Brake Condition		الفرامل
04.A Brake Pedal	SPONGY WEAK	دواسة الفرامل
05 Lights		الاضاءة
05.A Fog light	MISSING	كشاف الضباب
05.B Warning Light	WARNING LIGHT ON DISPLAY	ضوء تحذير
06 Steering Condition		المقود
06.A Steering Oil	OIL LEAK	زيت المقود
06.B Tie Rod End	BOOT CUT	مؤخرة الرودادات
06.C Steering Boot	BOOT CUT	ربلة المقود
07 Engine Condition		المحرك
07.A Visual Engine Condition	OIL LEAK & REFITTED	حالة المحرك النظري
08 Transmission Condition		الجير
08.A Road Test	NOT CHECK	فحص علي الطريق
08.B Visual Gear Box Condition	OIL LEAK & REFITTED	حالة الجير النظري
09 Suspension System		ممتص الصدمات
09.A Arms	FRONT LOWER ARM BUSH CUT	ازرع
09.B Leaf Spring	LEAF SPRING BUSHES WORN OUT	
09.C Ball Joint	BOOT CUT	مفصل كروي
10 Tires and Rims Condition		الاطارات
10.A Front Tyre	BOTH SIDE 2018 & CRACKED	الاطار الامامي
10.B Rear Tyre	BOTH SIDE 2018 & CRACKED	الاطار الخلفي
10.C Spare Tire & Tools	SPARE TIRE MISSING	الاطار الاحتياطي و العدة

- The inspection report is valid and shows the vehicle's condition at the time of the inspection only. Car Check doesn't guarantee the vehicle's condition as soon as it leaves the inspection station, and from then on, the inspection is considered invalid.
- Car Check is not responsible for hidden defects of the vehicle, and according to this certificate, Car Check does not guarantee the vehicle's



- شهادة الفحص سارية وتظهر حالة المركبة وقت الفحص فقط، ولا تضمن كار تشيك حالة المركبة بمجرد خروجها من محطة الفحص، ويعتبر الفحص في هذه الحالة غير ساري.
- كار تشيك غير مسؤولة عن العيوب الخفية في المركبة، كما لا تضمن بموجب هذه الشهادة صلاحية المركبة للتسجيل من عدمه.

fitness for registration.

Test Certificate

✓ PASS



Vehicle
Registration



Change possession :	66701091
Chassis No :	2GCEK19J981149654
Vehicle Make :	CHEVROLET
Vehicle Model :	SILVERADO
Vehicle Class :	Light Vehicle
Body Type :	PICK-UP
Fuel :	Benzene
Color :	Gray
Drive Direction :	--
Dimensions : (H x W x L)	-- x -- x --
Current Odometer :	90218 Kms. x
Origin : United States	Model Year : 2008
Gear Type : Automatic	Engine Size : 5300 CC
Engine No : NIL	Horse : 315
Axles No : 2	Power :
No Of : 4	Cylinders : 8
Doors :	No Of Seats : 6
G. V. W. : 2800 Kgs.	Empty : 2000 Kgs.
	Weight :

Certificate Number :	5-TAS-2022-17215381		
Inspection Date :	17-07-2022		
Certificate Print Date :	17-07-2022		
Services :	Registration Test		
Vehicle Testing Partner :	Tasjeel		
Vehicle Testing Center :	Tasjeel Al Aweer		
Total Time Taken :	10 min 14 sec		
Appointment Ref Number :	--		
Start Time :	14:26	End Time :	14:36
Lane :	02	Token No. :	195
Attempt :	1	Prints No. :	1

Carbon footprint



Your immediate action to protect Dubai environment is required


Estimated Vehicle Consumption (Rate last 12 Months)

82576 KM	8497 L	26681 AED	20.4 ton
Distance per year	Fuel consumed per year	Fuel cost per year	Carbon footprint per year

Parameter Readings

Service brake imbalance on front axle 3 %	Service brake imbalance on rear axle 1 %	Parking brake imbalance between LHS and RHS 22 %	Vehicle on Petrol CO Reading 0.97 %
Vehicle on Petrol HC Reading 158 PPM VOL			

Inspection Remarks: left side chassis repaired , dent // old // minor steering oil leak // under body minor rusty //

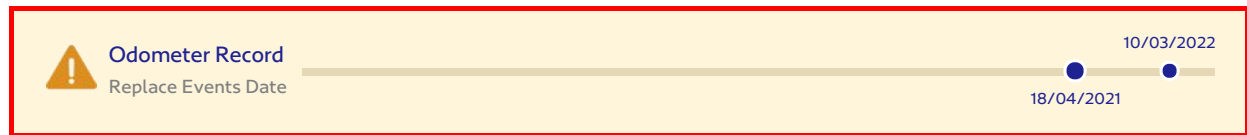

Payment Details

Inspection Performed by 30544	Payment Method Cash	Transaction Number 17215381	Service Fees AED 170 Collected on 17/07/2022
Parking Slot No --	Service Name Registration Test	Attempt 1	Received by Bajurdeen Abdul Gafoor

This is to acknowledge the receipt of AED 170 (in words: One Hundred and Seventy Dirhams Only.), towards the above service.

Information in this certificate regarding the annual consumption rate of the vehicle is based on estimated calculations.

تستخدم هذه الشهادة حصرا في العمليات الخاصة بالترخيص الفني للمركبة. لا يعتد بهذه الشهادة لأي عمليات أخرى بما في ذلك أغراض البيع أو الشراء خلاف عملية ترخيص المركبة. لا تتحمل الجهة المصدرة أية مسؤولية جراء استعمال هذه الشهادة لغير ما أصدرت من أجله. هذه الشهادة صالحة لإجراء معاملة واحدة فقط خلال 30 يوم من تاريخ الفحص.

This certificate is used exclusively in the technical licensing process for vehicle. This certificate should not be valid for any process including selling or buying purposes other than vehicle licensing process. The issuing entity shall not bear any liability for using this certificate for any purposes other than those it was issued for. This certificate is valid for one transaction only for 30 days from the date of inspection.

