

Legal Entity Name	: ENOC TASJEEL L.L.C	Vehicle Year Model	: 2012
Site Location	: 840-EMIRATES AUCTION	Vehicle Make/Model	: NISSAN/PICK UP
Tester ID(1)	: 27070 - RAYOS	Tester ID(2)	: 27070 - RAYOS
Test Date And Time	: 04 JUL 2020 10:28:32	Vehicle Type	: LIGHT VEHICLE
Test Type	: DSC AUCTION	Vehicle Color	: WHITE
Test Count	:	Vehicle Category	:
Token Number	: 192397	Un laden Weight	:
Transaction Number	: 20130639	Laden Weight	:
Reference import Doc.	:	Number of Axles	:
Plate Location Place	: DXB	Number of Doors	:
Plate Number	: 002108 EA	Number of Seats	:
Plate Category	: PRIVATE	Number of Cylinders	: 4
Plate Code	: 0	Fuel Type	: PETROL
Engine Number	:	Odometers	:
Chassis Number	: MNTDD22S3C6002108	Agcc	: YES

Statement of Vehicle Condition.

حالة المركبة

Defect	Result	Remarks	Test Value	
AUTOMATIC TEST:				
Brake System				الفرامل
Brake Test	Passed			فحص الفرامل
Exhaust Gas Test				الغاز العادم والكربون
Exhaust Gas Test	Passed		HC 0.000	فحص الغاز العادم-الكربون
Exhaust Gas Test	Passed		CO 0.000	فحص الغاز العادم-الكربون
Side Slip Test				فحص ميزانية الاطارات
Side Slip Test	Passed			فحص ميزانية الاطارات
EXPORT/IMPORT DATA:				
Export/Import Data				بيانات تصدير / استيراد المركبة
No. Of Cylinders	4			عدد الاسطوانات
Agcc	YES			المواصفات الخليجية
Chassis Number	MNTDD22S3C6002108			رقم الشاسي
VISUAL TEST:				
Lights				الانوار
Tail Lights		RIGHT SIDE LENS CRACKED		الانوار الخلفية
Steering And Suspension System				عجلة القيادة ونظام التوصيلات
Steering Ball Joints, Boots		BALL JOINT RUBBER WORN		وصلات عمود عجلة القيادة
Tires Rims				الاطارات والعجلات



Legal Entity Name	: ENOC TASJEEL L.L.C	Vehicle Year Model	: 2012
Site Location	: 840-EMIRATES AUCTION	Vehicle Make/Model	: NISSAN/PICK UP
Tester ID(1)	: 27070 - RAYOS	Tester ID(2)	: 27070 - RAYOS
Test Date And Time	: 04 JUL 2020 10:28:32	Vehicle Type	: LIGHT VEHICLE
Test Type	: DSC AUCTION	Vehicle Color	: WHITE
Test Count	:	Vehicle Category	:
Token Number	: 192397	Un laden Weight	:
Transaction Number	: 20130639	Laden Weight	:
Reference import Doc.	:	Number of Axles	:
Plate Location Place	: DXB	Number of Doors	:
Plate Number	: 002108 EA	Number of Seats	:
Plate Category	: PRIVATE	Number of Cylinders	: 4
Plate Code	: 0	Fuel Type	: PETROL
Engine Number	:	Odometers	:
Chassis Number	: MNTDD22S3C6002108	Agcc	: YES

Statement of Vehicle Condition.

حالة المركبة

Defect	Result	Remarks	Test Value
Front Left And Right Hands Tires		DOT 2116-2217	الاطارات الامامية
Body			الهيكل
Paint		DENT/SCRTACHES	الصبغ
Bumpers		MIDDLE FLOORING REPAIRED/TANK OPENER SWITCH NOT WORKING	الدعامية
Roof		REAR GRILL PARTLY RUSTY	المسقف
Floor		LEFT SIDE RUNNING BOARD/LEFT SIDE DOOR & REAR LEFT FENDER REPAIRED	الارضية
Chassis (Frame)		FRONT CHASSIS REPAIRED/BEND/BODY MOUNTING WELDED REPAIRED/MIS ALIGN	الشاصية
Front And Rear Windshields		FRONT REPLACED & RADIO ANTENNA BROKEN/RADIO NOT WORKING	الزجاج الامامي والخلفي
Side Safety Frame		FRONT & REAR BUMPER/BULKHEAD/BONNET/FENDER & FRAME REPAIRED	الواقبات الجانبية
General Items			الاشياء العامة
Seats Condition And Seats Fixing		PARTLY TORN	المقاعد وحالتها وتثبيتها
Engine Condition, Smoke		ENGINE UNUSUAL SOUND WHEN ACCELERATE	حالة المحرك - الدخان
Remarks			ملاحظات
Chassis No.		VIN NUMBER IN DASH BOARD MISSING.	رقم الشاصي
Auction			الفحص الكامل
Need Wheel Alignment		VIBRATION//SOUND/ALIGNMENT/LEAF	بحاجة الى ميزانية العجلات




Legal Entity Name	: ENOC TASJEEL L.L.C	Vehicle Year Model	: 2012
Site Location	: 840-EMIRATES AUCTION	Vehicle Make/Model	: NISSAN/PICK UP
Tester ID(1)	: 27070 - RAYOS	Tester ID(2)	: 27070 - RAYOS
Test Date And Time	: 04 JUL 2020 10:28:32	Vehicle Type	: LIGHT VEHICLE
Test Type	: DSC AUCTION	Vehicle Color	: WHITE
Test Count	:	Vehicle Category	:
Token Number	: 192397	Un laden Weight	:
Transaction Number	: 20130639	Laden Weight	:
Reference import Doc.	:	Number of Axles	:
Plate Location Place	: DXB	Number of Doors	:
Plate Number	: 002108 EA	Number of Seats	:
Plate Category	: PRIVATE	Number of Cylinders	: 4
Plate Code	: 0	Fuel Type	: PETROL
Engine Number	:	Odometers	:
Chassis Number	: MNTDD22S3C6002108	Agcc	: YES

Statement of Vehicle Condition.

حالة المركبة


Defect	Result	Remarks	Test Value
Gear Box Oil Leaking		SPRING BUSH CRACKED GEAR OIL LEAK	تهريب زيت الجير
Sign Of Front Accident			أثر حادث في مقدمة المركبة
Sign Of Side Accident			أثر حادث في جوانب المركبة
A/C Not Cooling			عطل في المكيف
Digital Display Damaged/Warning Lights		WARNING LIGHT ON/DOME,FRONT PARK/FRONT RIGHT FENDER/PLATE LIGHT NOT WORKING	عطل في لوحة التحكم الإلكتروني
Body Repainted		BODY PORTION REPAINTED	أثر صبغ في المركبة

The Test Certificate Shows the test Result at the time of inspection only.
Tasjeel is not responsible for any hidden defects.

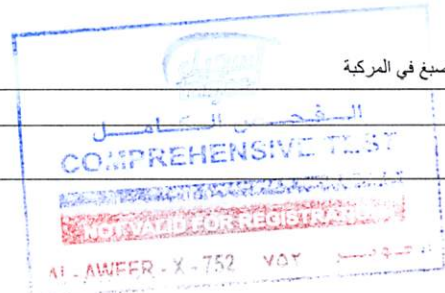

Test Certificate

PASS

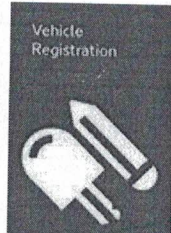

RTA

Possession Certificate : 64022184

Chassis No : MNTDD2253C6002108

Vehicle Make : NISSAN

Vehicle Model : PICK UP

Vehicle Class : Light Vehicle

Body Type : PICK-UP

Fuel : Benzene

Color : Advertismen Stiker, Blue, White

Drive Direction : --

Dimensions : (H x W x L) -- x -- x --

Current Odometer : 302073 Kms.

Origin : Thailand

Model Year :

Gear Type : --

2012

Engine No : KA2488985...

Engine Size :

2400 CC

Axles No : 2

Horse Power :

--

No Of Doors : 2

G. V. W. : 2570 Kgs.

Cylinders :

4

No Of Seats :

3

Empty Weight :

1830 Kgs.

Certificate Number : 5-MUT-2020-12085507

Inspection Date : 01-07-2020

Certificate Print Date : 01-07-2020

Services : Registration Test

Vehicle Testing Partner : Al Mutakamela Vehicle Testing LLC

Vehicle Testing Center : Al Mutakamela Vehicle Testing Al Qouz

Total Time Taken : 1 min 43 sec

Appointment Ref Number : --

Start Time :

21:17

End Time :

21:19

Lane :

02

Token No. :

515

Attempt :

2

Prints No :

1

Carbon footprint



2.4 ton

ton CO2

Thank you! You are environment protector

Estimated Vehicle Consumption (Rate last 12 Months)



9653 KM

Distance per
year



994 L

Fuel consumed
per year



1611 AED

Fuel cost per
year



2.4 ton

Carbon footprint
per year

Inspection Findings

Discrepancies

Paint Removed Advertisement

Old Value

New Value

Verified

Advertisement Stiker , Blue White
, White

Inspection Remarks:

FRONT BUMPER FRAME,FENDER,FENDER FRAME,RADIATOR SUPPORT,CROSS MEMBER,FRONT RIGHT SIDE WHEEL ARCH AREA REPAIRED,FRONT RIGHT SIDE BODY MOUNTING AREA REPAIRED

Payment Details

Inspection Performed by
31315

Parking Slot No

--

Payment Method

Cash

Service Name

Registration Test

Transaction Number

12085507

Attempt

2

Service Fees

AED 70 Collected on 01/07/2020

Received by

Shaeema Abdul Ghafoor Baloch

1 This is to acknowledge the receipt of AED 70 (in words: Seventy Dirhams Only.), towards the above service.

2 Information in this certificate regarding the annual consumption rate of the vehicle is based on estimated calculations.

هذه الشهادة صالحة لإجراء معاملة واحدة فقط خلال 30 يوم من تاريخ الفحص . المؤسسة غير مسئولة عن العيوب الغير مرئية و الفحص الفني يتم ظاهرياً طبقاً لقانون السير و المرور لسنة 1995

This certificate is valid for one transaction only for 30 days from the date of inspection. Company not responsible for any hidden defects and inspection done-According to Traffic law No., 21 year 1995

