




TEST CERTIFICATE

| | | | |
|--------------------|-----------------------|------------------|-----------------------|
| Site Number | 840-Emirates Auctions | Transaction Date | 20 Sep 2022, 17:56:17 |
| Transaction Number | 36961982 (CC10009) | Queue Number | 593715 |

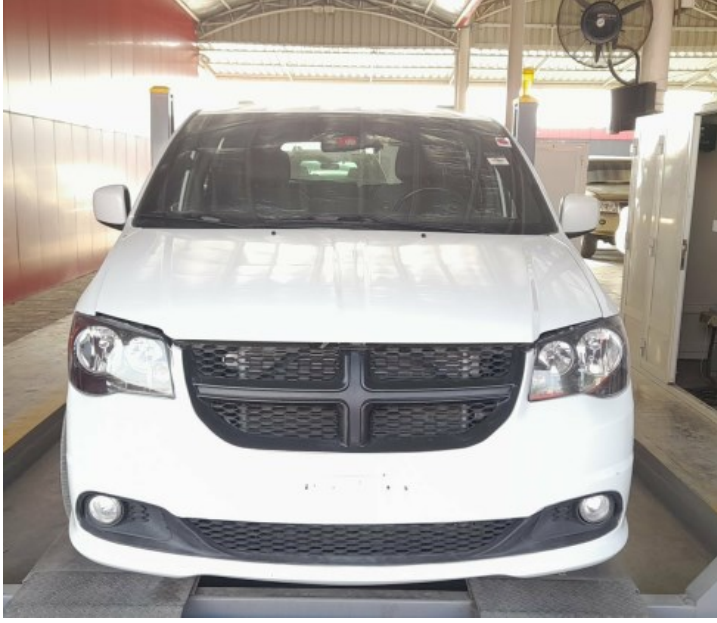

| | |
|------------------|-------------------|
| Chassis Number | 2C4RDGEG8KR693998 |
| Engine Number | |
| Vehicle Class | Car |
| Manufacturer | Dodge |
| Model | Grand Caravan |
| Model Year | 2019 |
| Color | White |
| Mileage | 62482 Km |
| Fuel Type | Petrol |
| No. Of Cylinders | 6 |
| Specification | USA Imported |

| DEFECT | REMARKS | |
|------------------------------------|--|----------------------------|
| 01 Tires and Rims Condition | | |
| | | الاطارات |
| 01.A Rear Tyre | BOTH SIDE 2021 | الاطار الخلفي |
| 01.B Front Tyre | BOTH SIDE 2021 | الاطار الامامي |
| 02 Engine Condition | | |
| | | المحرك |
| 02.A Visual Engine Condition | OIL LEAK | حالة المحرك النظرى |
| 02.B Mount | MOUNT RUBBER CRACKED | كرسي |
| 03 Transmission Condition | | |
| | | الجير |
| 03.A Road Test | NOT CHECK | فحص علي الطريق |
| 03.B Visual Gear Box Condition | MINOR OIL LEAK | حالة الجير النظرى |
| 03.C Gear Box Mount | MOUNT RUBBER CRACKED | كرسي الجير |
| 04 Body | | |
| | | جسم المركبة |
| 04.A Fenders | FRONT REFITTED | مدكار |
| 04.B Bonnet | REFITTED,CABLE DAMAGED | غطاء المحرك |
| 04.C Sign of front accident | | وجود مؤشر لحادث في المقدمة |
| 04.D Floor | PORTION REPAIRED | الارضية |
| 04.E Pillars | FRONT LEFT SIDE PILLAR INNER COVER LOOSE | القوائم |

| DEFECT | REMARKS | |
|------------------------------|--|------------------------|
| 04.F Paint | BODY TOTALLY REPAINTED PORTION REPAIRED , MINOR DENTS SCRATCHES | الصبغ |
| 04.G Other | FRONT BUMPER FRAME BULK HEAD FENDER FRAME RADIATOR SUPPORT,SUBFRAME REPAIRED | اخرى |
| 05 Interior Condition | | الحالة الداخلية |
| 05.A AC Condition | OK | المكيف |
| 05.B Roof Ceiling | PORTION LOOSE | بطانه السقف |
| 05.C Sun Visor | RIGHT SIDE LOCK DAMAGED | حاجب الشمس |
| 05.D Roof Light | NOT WORKING | أنارة السقف |
| 06 Suspension System | | ممتص الصدمات |
| 06.A Ball Joint | BOOT CUT | مفصل كروي |
| 06.B Arms | LOWER ARM BUSHES CUT | ازرع |
| 07 Steering Condition | | المقود |
| 07.A Tie Rod End | BOOT CUT | مؤخرة الرودادات |
| 08 Chassis Condition | | الشاصي |
| 08.A Chassis | FRONT BOTH SIDE CHASSIS REPAIRED | الشاسيه |
| 08.B Chassis Number | VIN NUMBER CHECKED ON WINDSHILED & STICKER | رقم القاعدة |
| 09 Lights | | الاضاءة |
| 09.A Warning Light | WARNING LIGHT ON IN DISPLAY | ضوء تحذير |

- The inspection report is valid and shows the vehicle's condition at the time of the inspection only. Car Check doesn't guarantee the vehicle's condition as soon as it leaves the inspection station, and from then on, the inspection is considered invalid.
- Car Check is not responsible for hidden defects of the vehicle, and according to this certificate, Car Check does not guarantee the vehicle's fitness for registration.



- شهادة الفحص سارية وتظهر حالة المركبة وقت الفحص فقط، ولا تضمن كار تشيك حالة المركبة بمجرد خروجها من محطة الفحص، ويعتبر الفحص في هذه الحالة غير ساري.
- كار تشيك غير مسؤولة عن العيوب الخفية في المركبة، كما لا تضمن بموجب هذه الشهادة صلاحية المركبة للتسجيل من عدمه.

Test Certificate



✓ PASS

| | |
|--------------------------|--------------------------|
| Plate Details : | Y 74162 Dubai Private |
| Chassis No : | 2C4RDGEG8KR693998 |
| Vehicle Make : | DODGE |
| Vehicle Model : | GRAND CARAVAN |
| Vehicle Class : | Light Vehicle |
| Body Type : | STATION |
| Fuel : | Benzene |
| Color : | White |
| Drive Direction : | -- |
| Dimensions : (H x W x L) | -- x -- x -- |
| Current Odometer : | 62479 Kms. |
| Origin : Canada | Model Year : 2019 |
| Gear Type : Automatic | Engine Size : 3000 CC |
| Engine No : nil | Horse -- |
| Axles No : 2 | Power : |
| No Of 4 | Cylinders : 6 |
| Doors : | No Of Seats : 7 |
| G. V. W. : 2700 Kgs. | Empty Weight : 2200 Kgs. |

| | | | |
|---------------------------|---------------------|--------------|-------|
| Certificate Number : | 5-TAS-2022-17655149 | | |
| Inspection Date : | 18-09-2022 | | |
| Certificate Print Date : | 18-09-2022 | | |
| Services : | Registration Test | | |
| Vehicle Testing Partner : | Tasjeel | | |
| Vehicle Testing Center : | Tasjeel Al Aweer | | |
| Total Time Taken : | 12 min 12 sec | | |
| Appointment Ref Number : | -- | | |
| Start Time : | 15:08 | End Time : | 15:21 |
| Lane : | 02 | Token No. : | 212 |
| Attempt : | 1 | Prints No. : | 1 |

Carbon footprint



Thank you! You are environment protector

Estimated Vehicle Consumption (Rate in 12 Months)

| | | | |
|-------------------|------------------------|--------------------|---------------------------|
| | | | |
| 14160 KM | 1458 L | 4856 AED | 3.5 ton |
| Distance per year | Fuel consumed per year | Fuel cost per year | Carbon footprint per year |

Parameter Readings

| | | | |
|--|---|--|--|
| Service brake imbalance on front axle 9 % | Service brake imbalance on rear axle 1 % | Parking brake imbalance between LHS and RHS 9 % | Vehicle on Petrol CO Reading 0.38 % |
| Vehicle on Petrol HC Reading 43 PPM VOL | | | |

Inspection Remarks:

front left side chassis repaired/ ccm ok trn-2022-08-11-1 tas ras alkhorr/Front bumper,bulk head,fender,fender frame,apron repaired/old

Payment Details

| | | | |
|----------------------------------|-----------------------------------|--------------------------------|---|
| Inspection Performed by 35063 | Payment Method Cash | Transaction Number 17655149 | Service Fees AED 170 Collected on 18/09/2022 |
| Parking Slot No -- | Service Name Registration Test | Attempt 1 | Received by Bajurdeen Abdul Gafoor |

① This is to acknowledge the receipt of AED 170 (in words: One Hundred and Seventy Dirhams Only.), towards the above service.

② Information in this certificate regarding the annual consumption rate of the vehicle is based on estimated calculations.

تستخدم هذه الشهادة حصرا في العمليات الخاصة بالترخيص الفني للمركبة. لا يعتد بهذه الشهادة لأي عمليات أخرى بما في ذلك أغراض البيع أو الشراء خلاف عملية ترخيص المركبة. لا تتحمل الجهة المصدرة أية مسؤولية جراء استعمال هذه الشهادة لغير ما أصدرت من أجله. هذه الشهادة صالحة لإجراء معاملة واحدة فقط خلال 30 يوم من تاريخ الفحص.



This certificate is used exclusively in the technical licensing process for vehicle. This certificate should not be valid for any process including selling or buying purposes other than vehicle licensing process. The issuing entity shall not bear any liability for using this certificate for any purposes other than those it was issued for. This certificate is valid for one transaction only for 30 days from the date of inspection.