



## TEST CERTIFICATE

Site Number	<b>840-Emirates Auctions</b>	Transaction Date	<b>12 Jan 2023, 16:56:32</b>
Transaction Number	<b>91321885 (CC10009)</b>	Queue Number	<b>656725</b>



Chassis Number	<b>JTHCL46F595004437</b>
Engine Number	
Vehicle Class	<b>Car</b>
Manufacturer	<b>Lexus</b>
Model	<b>LS 460</b>
Model Year	<b>2009</b>
Color	<b>White</b>
Mileage	<b>178188 Miles</b>
Fuel Type	<b>Petrol</b>
No. Of Cylinders	<b>8</b>
Specification	<b>Imported</b>

DEFECT	REMARKS	
<b>01 Transmission Condition</b>		<b>الجير</b>
01.A Visual Gear Box Condition	MINOR OIL LEAK	حالة الجير النظري
01.B Gear Box Mount	MOUNT RUBBER CUT	كرسي الجير
01.C Road Test	NOT CHECK	فحص علي الطريق
<b>02 Suspension System</b>		<b>ممتص الصدمات</b>
02.A Arms	LOWER ARM BUSHES CUT	ازرع
02.B Ball Joint	BOOT CUT	مفصل كروي
<b>03 Body</b>		<b>جسم المركبة</b>
03.A Sign of front accident		وجود مؤشر لحادث في المقدمة
03.B Sign of side accident		وجود مؤشر لحادث في الجانب
03.C Fenders	FRONT LEFT REPLACED	مدكار
03.D Floor	FLOOR PORTION DENT , CHASSIS AREA COVERED CHECKED VISIBLE AREA ONLY	الارضية
03.E Paint	BODY TOTALY REPAINTED & PORTION REPAIRED,MINOR DENT,SCRATCHES	الصبغ
03.F Pillars	DOOR PILLARS REPAINTED	القوائم

DEFECT	REMARKS	
<b>04 Engine Condition</b>		<b>المحرك</b>
04.A Smoke	BLACK SMOKE	دخان
04.B Visual Engine Condition	MINOR OIL LEAK , SIGN OF COOLANT WATER LEAK	حالة المحرك النظرى
<b>05 Lights</b>		<b>الاضاءة</b>
05.A Warning Light	WARNING LIGHT ON DISPLAY	ضوء تحذير
05.B Head Light	LENS FADED	الاضاءة الرئيسية
<b>06 Seats Condition</b>		<b>المقاعد</b>
06.A Seat Condition	DRIVER SEAT CRACKED	حالة المقاعد
<b>07 Interior Condition</b>		<b>الحاله الداخليه</b>
07.A AC Condition	OK	المكيف
07.B Door Panel	LEFT SIDE BOTH WORN OUT	لوحة بطانة الباب
07.C Dash Board	WORN OUT	لوحة القيادة
<b>08 Steering Condition</b>		<b>المقود</b>
08.A Tie Rod End	BOOT CUT	مؤخرة الرودادات
08.B Axle	LEAK	اكسلات
<b>09 Tires and Rims Condition</b>		<b>الاطارات</b>
09.A Rear Tyre	BOTH SIDE 2020	الاطار الخلفي
09.B Front Tyre	BOTH SIDE 2020	الاطار الامامي
<b>10 Chassis Condition</b>		<b>الشاسي</b>
10.A Chassis	FRONT LEFT SIDE OUTER SKIRT REPAIRED RUST PROOFED	الشاسيه

- The inspection report is valid and shows the vehicle's condition at the time of the inspection only. Car Check doesn't guarantee the vehicle's condition as soon as it leaves the inspection station, and from then on, the inspection is considered invalid.
- Car Check is not responsible for hidden defects of the vehicle, and according to this certificate, Car Check does not guarantee the vehicle's fitness for registration.



- شهادة الفحص سارية وتظهر حالة المركبة وقت الفحص فقط، ولا تضمن كار تشيك حالة المركبة بمجرد خروجها من محطة الفحص، ويعتبر الفحص فى هذه الحالة غير ساري.
- كار تشيك غير مسؤولة عن العيوب الخفية في المركبة، كما لا تضمن بموجب هذه الشهادة صلاحية المركبة للتسجيل من عدمه.

# Test Certificate



Vehicle  
Registration




✓ PASS

Plate Details :	--
Chassis No :	JTHCL46F595004437
Vehicle Make :	LEXUS
Vehicle Model :	LS460
Vehicle Class :	Light Vehicle
Body Type :	SALOON
Fuel :	Benzene
Color :	White
Drive Direction :	--
Dimensions : (H x W x L)	-- x -- x --
Current Odometer :	286770 Kms.
Origin : Japan	Model Year : 2009
Gear Type : Automatic	Engine Size : 5000 CC
Engine No : nil	Horse : 357
Axles No : 2	Power :
No Of : 4	Cylinders : 8
Doors :	No Of Seats : 5
G. V. W. : 2200 Kgs.	Empty : 1550 Kgs.
	Weight :

Certificate Number :	5-TAS-2023-18607874		
Inspection Date :	21-01-2023		
Certificate Print Date :	21-01-2023		
Services :	Registration Test		
Vehicle Testing Partner :	Tasjeel		
Vehicle Testing Center :	Tasjeel Al Aweer		
Total Time Taken :	4 min 29 sec		
Appointment Ref Number :	--		
Start Time :	13:27	End Time :	13:31
Lane :	02	Token No. :	164
Attempt :	2	Prints No. :	1

## Carbon footprint

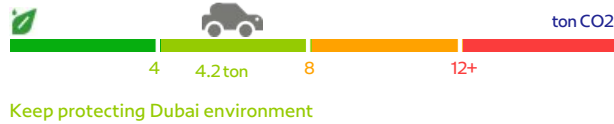

## Estimated Vehicle Consumption (Rate in 12 Months)

16868 KM	1736 L	6024 AED	4.2 ton
Distance per year	Fuel consumed per year	Fuel cost per year	Carbon footprint per year

Inspection Remarks: front fender frame , bulk head repaired // under neath oil wetness //

## Payment Details

Inspection Performed by 30544	Payment Method Cash	Transaction Number 18607874	Service Fees AED 70 Collected on 21/01/2023
Parking Slot No --	Service Name Registration Test	Attempt 2	Received by Bajurdeen Abdul Gafoor

- This is to acknowledge the receipt of AED 70 (in words: Seventy Dirhams Only.), towards the above service.
- Information in this certificate regarding the annual consumption rate of the vehicle is based on estimated calculations.

تستخدم هذه الشهادة حصرا في العمليات الخاصة بالترخيص الفني للمركبة. لا يعتد بهذه الشهادة لأي عمليات أخرى بما في ذلك أغراض البيع أو الشراء خلاف عملية ترخيص المركبة. لا تتحمل الجهة المصدرة أية مسؤولية جراء استعمال هذه الشهادة لغير ما أصدرت من أجله. هذه الشهادة صالحة لإجراء معاملة واحدة فقط خلال 30 يوم من تاريخ الفحص.

This certificate is used exclusively in the technical licensing process for vehicle. This certificate should not be valid for any process including selling or buying purposes other than vehicle licensing process. The issuing entity shall not bear any liability for using this certificate for any purposes other than those it was issued for. This certificate is valid for one transaction only for 30 days from the date of inspection.

