

Queue Number 2899408

Transaction Date 23 Oct 2026, 15:59:46

Site Name
840 - Emirates AuctionsTransaction Number
60700157 (CC10009) (CC10012)

Vehicle Details

Chassis Number	JN8AY25Y1A*****
Specification	GCC Specification
Make	Nissan
Model	Patrol
Model Year	2010
Color	White
Mileage	1302011 Km
Fuel Type	Petrol
Transmission Type	
No. Of Cylinders	8

Condition

Remarks

الحالة

01 Body

جسم المركبة

01.A Paint	BODY REPAINTED PORTION REPAIRED MINOR DENT SCRATCHES , PORTION FADED , PORTION RUSTY	الصبغ
01.B Rusty	UNDER BODY PARTS GETTING RUSTY	صدأ
01.C Floor	FLOOR CHASSIS MUDDY	الارضية
01.D Bumper	MISALIGN , GRILL BRACKET CRACK	دعامية
01.E Bonnet	REFITTED , SHOCK WEAK NOT WORK	غطاء المحرك
01.F Trunk	MISALIGN , BUTTON DAMAGED	صندوق

02 Chassis Condition

الشاسي

02.A Chassis	CHASSIS PORTION GETTING RUSTY/OK	الشاسيه
--------------	----------------------------------	---------

03 Engine Condition

المحرك

03.A Engine Visual Condition	OIL LEAK REFITTED GETTING RUSTY	الحالة النظرية للمحرك
------------------------------	---------------------------------	-----------------------

04 Seats Condition

المقاعد

04.A Seat Condition	SEAT EXTRA COVER , DRIVER SEAT PORTION LOOSE	حالة المقاعد
---------------------	--	--------------


05 Exhaust System

نظام العادم

05.A Other	CUT REWELDED	اخرى
------------	--------------	------

06 Transmission Condition

الجير

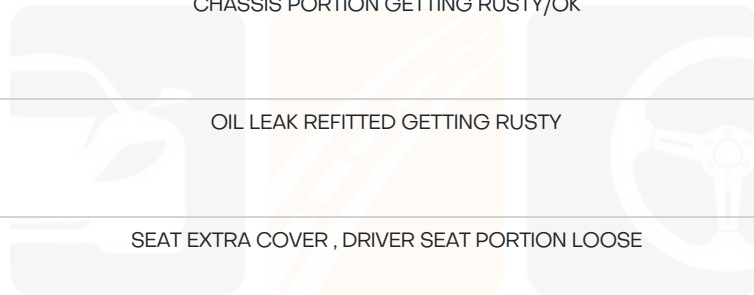

Condition	Remarks	الحالة
06.A Gear Box Visual Condition	OIL WET REFITTED GETTING RUSTY,MINOR JERKING	الحالة النظرية للجير
06.B Road Test	NOT CHECKED	فحص علي الطريق
07 Tires and Rims Condition		الاطارات
07.A Front Tyre	BOTH SIDE 2025	الاطار الامامي
07.B Rear Tyre	BOTH SIDE 2025	الاطار الخلفي
08 Lights		الاضاءة
08.A Tail Light	RIGHT SIDE MINOR CRACK	الضوء الخلفي
09 Suspension System		ممتص الصدمات
09.A Arms	LOWER ARM BUSHES CRACKED	ازرع
10 Interior Condition		الحالة الداخليه
10.A Other	INTERIOR PARTS RUSTY , (SIGN OF FLOODED)	اخرى
10.B Mirror	AUTO NOT WORKING , LOOSE	المرايا
10.C AC Condition	OK	المكيف
10.D Floor Matting	EXTRA COVER	فرش الأرضيه
10.E Dash Board	LEATHER REPLACED , WORN OUT , PORTION LOOSE ,CRACK	لوحة القيادة
10.F Door Panel	WORN OUT	لوحة بطانة الباب
10.G Steering Wheel and control buttons	WORN OUT	عجلة القيادة وازرار التحكم

you can verify the validity of the certificate via the link: carcheck.ae/certificate



يمكنك التحقق من صحة الشهادة عبر الرابط carcheck.ae/certificate

Terms & Conditions

الشروط والأحكام

The inspection report is valid and shows the vehicle's condition at the time of the inspection only. Car Check doesn't guarantee the vehicle's condition as soon as it leaves the inspection station, and from then on, the inspection is considered invalid.

شهادة الفحص سارية وتظهر حالة المركبة وقت الفحص فقط، ولا تضمن كار تشيك حالة المركبة بمجرد خروجها من محطة الفحص، ويعتبر الفحص في هذه الحالة غير ساري.

Car Check is not responsible for hidden defects of the vehicle, and according to this certificate, Car Check does not guarantee the vehicle's fitness for registration.

كار تشيك غير مسؤولة عن العيوب الخفية في المركبة، كما لا تضمن بموجب هذه الشهادة صلاحية المركبة للتسجيل من عدمه

For complaints and inquiries reach out to us on wecare@carscheck.ae

للشكاوي والمقترحات يمكنك التواصل معنا عبر wecare@carscheck.ae