

## **TEST CERTIFICATE**

Site Number
Transaction Number

**05 Suspension System** 

05.A Ball Joint

840-Emirates Auctions 31758047 (CC10008) Transaction Date

12 May 2022, 15:27:55

ممتص الصدمات

مفصل كروي

Queue Number 312309

Chassis Number

2GKFL8E30D6287618

Engine Number

Vehicle Class Car

Manufacturer **GMC** 

Model **Terrain** 

Model Year 2013


Color Red

Mileage 98685 Km

Fuel Type Petrol

No. Of Cylinders

Specification GCC Specification

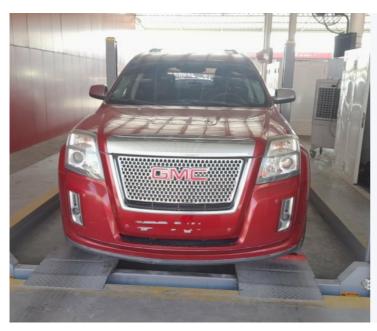

**DEFECT REMARKS 01 Interior Condition** الحاله الداخليه 01.A Dash Board **WORN OUT** لوحة القياده 01.B AC Condition ОК المكيف **02 Tires and Rims Condition** الاطارات 02.A Front Tyre **BOTH SIDE 2019** الاطار الامامى **BOTH SIDE 2019** 02.B Rear Tyre الاطار الخلفى **03 Engine Condition** المحرك 03.A Mount MOUNT RUBBER CRACKED كرسي 03.B Visual Engine Condition OIL LEAK , REFITTED , حالة المحرك النظرى **04 Transmission Condition** الجير 04.A Visual Gear Box MINOR OIL LEAK REFITTED حالة الجير النظرى Condition MOUNT RUBBER MINOR CRACKED 04.B Gear Box Mount كرسى الجير 04.C Road Test **NOT CHECKED** فحص علي الطريق

**BOOT CUT** 

DEFECT	REMARKS	
05.B Arms	BOTH SIDE LOWER ARM BUSHES CRACKED	ازرع
06 Steering Condition		المقود
06.A Tie Rod End	BOOT CUT	مؤخرة الرودات
07 Chassis Condition		الشاصي
07.A Chassis	OK	الشاسيه
O8 Body		جسم المركبة
08.A Paint	BODY PORTION REPAINTED, PORTION REPAIRED, MINOR DENT, SCRATCHES	الصبغ
08.B Doors	RIGHT BOTH SIDE REPAINTED, PORTION REPAIRED	أبواب
09 Lights		الاضاءة
09.A Warning Light	WARNING LIGHT ON IN DISPLAY	ضوء تحذير

- The inspection report is valid and shows the vehicle's condition at the time of the inspection only. Car Check doesn't guarantee the vehicle's condition as soon as it leaves the inspection station, and from then on, the inspection is considered invalid.
- Car Check is not responsible for hidden defects of the vehicle, and according to this certificate,
   Car Check does not guarantee the vehicle's fitness for registration.



- شهادة الفحص سارية وتظهر حالة المركبة وقت الفحص فقط، ولا تضمن كار تشيك حالة المركبة بمجرد خروجها من محطة الفحص، ويعتبر الفحص فى هذه الحالة غير ساري.
- كار تشيك غير مسؤولة عن العيوب الخفية في المركبة، كما لا تضمن بموجب هذه الشهادة صلاحية المركبة للتسجيل من عدمه.