

Queue Number

2837262

Transaction Date

07 Oct 2026, 13:20:35

Site Name

840 - Emirates Auctions

Transaction Number

58750697 (CC10021) (CC10019)



Vehicle Details

Chassis Number	5NPE34AF7F*****
Specification	Imported
Make	Hyundai
Model	Sonata
Model Year	2015
Color	Blue
Mileage	N/A NA
Fuel Type	Petrol
Transmission Type	
No. Of Cylinders	4

Condition

Remarks

الحالة

01 Body

جسم المركبة

01.A Paint	BODY PORTION REPAINTED PORTION REPAIRED PORTION GETTING RUSTY FADED MINOR DENT SCRATCHES	الصبغ
01.B Rusty	UNDER BODY PARTS ,SUSPENSION GETTING RUSTY	صدأ
01.C Floor	UNDER FLOOR PORTION DENTS, MUDDY	الارضية
01.D Bumper	MISALIGN , PORTION DAMAGED	دعامية

02 Chassis Condition

الشاسي

02.A Chassis	CHASSIS COVERED,MUDDY,CHECKED VISIBLE AREA ONLY PORTION MINOR DENT	الشاسية
02.B Other	NEED TO REMOVE BOTH SIDE FENDER INNER COVER FOR PROPER INSPECTION	اخرى

03 Engine Condition

المحرك

03.A Engine Visual Condition	ENGINE NOT START ,ALL SYSTEM NOT CHECKED PARTS REFITTED PARTS RUSTY	الحالة النظرية للمحرك
------------------------------	---	-----------------------

04 Seats Condition

المقاعد

04.A Seat Condition	PORTION WORN OUT	حالة المقاعد
---------------------	------------------	--------------

05 Transmission Condition

الجير

05.A Gear Box Visual Condition	NOT CHECKED PARTS REFITTED MINOR PARTS RUSTY	الحالة النظرية للجير
--------------------------------	--	----------------------


05.B Road Test

NOT CHECKED

فحص علي الطريق

06 Tires and Rims Condition

الاطارات

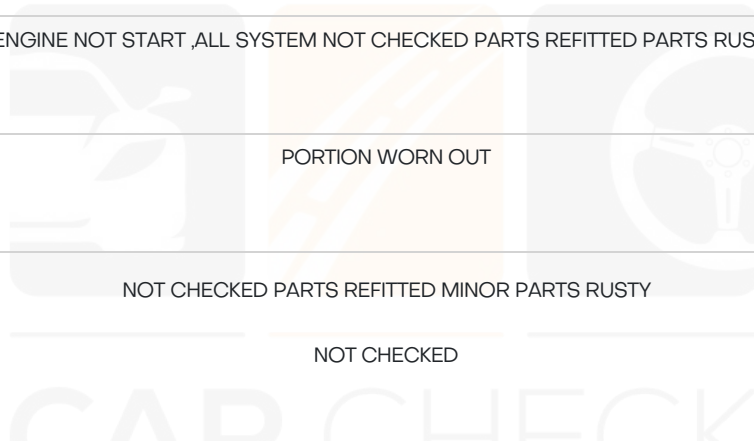

Condition	Remarks	الحالة
06.A Front Tyre	BOTH SIDE 2025 WORN OUT	الاطار الامامي
06.B Rear Tyre	BOTH SIDE 2025 WORN OUT	الاطار الخلفي
06.C Rims Condition	MINOR DENT SCRATCHES	حالة الجنوط
07 Lights		الاضاءة
07.A Head Light	LENS FADED ALL LIGHT NOT CHECK	الاضاءة الرئيسية
08 Brake Condition		الفرامل
08.A Disc&Drum	RUSTY	دسك وطنايير الفرامل
09 Suspension System		ممتص الصدمات
09.A Arms	BUSHES CRACK	ازرع
09.B Ball Joint	BOOT CUT	مفصل كروي
09.C Stabilizer Bar And Link Rod	BOOT CUT	عمود التوازن و مثبت عمود التوازن
10 Interior Condition		الحالة الداخلية
10.A Other	CENTER CONSOLE BOX COVER CRACKED & INTERIOR PARTS GETTING RUSTY	اخرى
10.B AC Condition	NOT CHECKED	المكيف
10.C Odometer reading	NOT CHECKED	قراءة عداد المسافات
10.D Door Panel	PORTION WORN OUT	لوحة بطانة الباب
10.E Steering Wheel and control buttons	WORN OUT	عجلة القيادة وازرار التحكم
10.F Gear Shifting Lever	KNOB WORN OUT	ذراع نقل السرعات

you can verify the validity of the certificate via the link: carcheck.ae/certificate



يمكنك التحقق من صحة الشهادة عبر الرابط carcheck.ae/certificate

Terms & Conditions

الشروط والأحكام

The inspection report is valid and shows the vehicle's condition at the time of the inspection only. Car Check doesn't guarantee the vehicle's condition as soon as it leaves the inspection station, and from then on, the inspection is considered invalid.

شهادة الفحص سارية وتظهر حالة المركبة وقت الفحص فقط، ولا تضمن كار تشيك حالة المركبة بمجرد خروجها من محطة الفحص، ويعتبر الفحص في هذه الحالة غير ساري.

Car Check is not responsible for hidden defects of the vehicle, and according to this certificate, Car Check does not guarantee the vehicle's fitness for registration.

كار تشيك غير مسؤولة عن العيوب الخفية في المركبة، كما لا تضمن بموجب هذه الشهادة صلاحية المركبة للتسجيل من عدمه

For complaints and inquiries reach out to us on wecare@carscheck.ae

للشكاوي والمقترحات يمكنك التواصل معنا عبر wecare@carscheck.ae