




## TEST CERTIFICATE

Site Number **840-Emirates Auctions** Transaction Date **05 Sep 2022, 16:44:10**  
 Transaction Number **78874158 (CC10008)** Queue Number **312309**

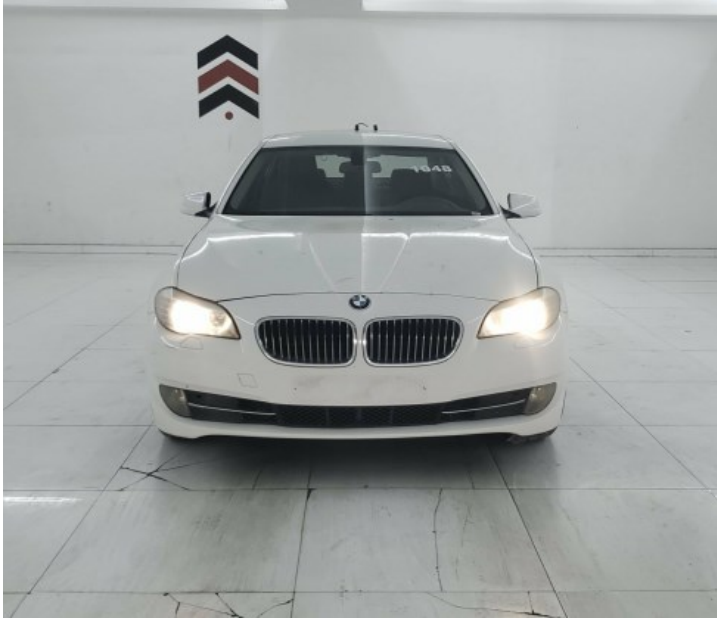

Chassis Number **WBAFR1100CC859836**  
 Engine Number  
 Vehicle Class **Car**  
 Manufacturer **BMW**  
 Model **530I**  
 Model Year **2012**  
 Color **White**  
 Mileage **252887 Km**  
 Fuel Type **Petrol**  
 No. Of Cylinders **6**  
 Specification **GCC Specification**

DEFECT	REMARKS	
<b>01 Chassis Condition</b> الشاشي		
01.A Chassis Number	CHASSIS NUMBER STICKER DAMAGED	رقم القاعدة
01.B Chassis	CHECKED ONLY VISIBLE AREA OK.	الشاسيه
<b>02 Lights</b> الاضاءة		
02.A Fog light	NOT WORKING	كشاف الضباب
02.B Head Light	LENS FADED	الاضاءة الرئيسية
02.C Warning Light	WARNING LIGHT ON IN DISPLAY	ضوء تحذير
<b>03 Suspension System</b> ممتص الصدمات		
03.A Arms	LOWER ARM BUSHES CUT.	ازرع
03.B Shock Absorber	WEAK	ممتص الصدمات
<b>04 Body</b> جسم المركبة		
04.A Paint	BODY TOTALY REPAINTED , PORTION REPAIRED , MINOR DENT SCRATCHES	الصبغ
04.B Bonnet	SHOCK WEAK	غطاء المحرك
04.C Floor	UNDER FLOOR COVERED ,CHECKED ONLY VISIBLE AREA	الارضية
04.D Roof	ROOF & ROOF RAIL PORTION HOLE	السقف

DEFECT	REMARKS	
<b>05 Tires and Rims Condition</b>		<b>الاطارات</b>
05.A Front Tyre	BOTH SIDE 2020 CRACKED	الاطار الامامي
05.B Rear Tyre	BOTH SIDE 2019/2020 CRACKED	الاطار الخلفي
<b>06 Wipers and Arms</b>		<b>المساحات</b>
06.A Other	WATER TANK CAP MISSING	اخرى
<b>07 Transmission Condition</b>		<b>الجير</b>
07.A Visual Gear Box Condition	REFITTED OIL LEAK	حالة الجير النظري
07.B Road Test	NOT CHECK	فحص علي الطريق
<b>08 Interior Condition</b>		<b>الحاله الداخليه</b>
08.A Steering Wheel and control buttons	GEAR SHIFTER DAMAGE SWITCH MISSING	عجلة القيادة وازرار التحكم
08.B Audio	LCD BLURRED .	صوتيات
08.C Roof Ceiling	LOOSE	بطانه السقف
08.D Dash Board	PORTION DAMAGED & CONSOLE BOX COVER DAMAGED	لوحة القيادة
08.E AC Condition	AC LOW COOLING,BLOWER WINDOW DAMAGE	المكيف
<b>09 Engine Condition</b>		<b>المحرك</b>
09.A Visual Engine Condition	ALL WIRING LOOSE IMPROPER FIXING,REFITTED OIL LEAK	حالة المحرك النظري
<b>10 Seats Condition</b>		<b>المقاعد</b>
10.A Seat Condition	FRONT BOTH SIDE SEAT ADJUSTMENT NOT WORKING & BACK COVER PORTION DAMAGED	حالة المقاعد
<b>11 Brake Condition</b>		<b>الفرامل</b>
11.A Brake Pedal	BRAKE PEDAL HARD .	دواسة الفرامل

- The inspection report is valid and shows the vehicle's condition at the time of the inspection only. Car Check doesn't guarantee the vehicle's condition as soon as it leaves the inspection station, and from then on, the inspection is considered invalid.
- Car Check is not responsible for hidden defects of the vehicle, and according to this certificate, Car Check does not guarantee the vehicle's fitness for registration.



- شهادة الفحص سارية وتظهر حالة المركبة وقت الفحص فقط، ولا تضمن كار تشيك حالة المركبة بمجرد خروجها من محطة الفحص، ويعتبر الفحص في هذه الحالة غير ساري.
- كار تشيك غير مسؤولة عن العيوب الخفية في المركبة، كما لا تضمن بموجب هذه الشهادة صلاحية المركبة للتسجيل من عدمه.