



### Test Certificate

Site Number	: 840-TASJEEL EM AUCTION	Plate Code	: 0
Transaction Number	: 18451966	Plate Category	: PRIVATE
Transaction Date	: 04 NOV 2019 15:31:37	Plate Number	: 5962 EA
Queue Number	: 115213	Import Doc. Ref.	:
Chassis Number	: WDCBF7BE6BA755962	Manufacturer/Model	: MERCEDES/GL 450
Engine Number	:	Model Year	: 2011
Vehicle Class	: LIGHT VEHICLE	Vehicle Color	: BLACK
Service / Indicator	: DSC AUCTION		

#### Statement of Vehicle Condition

Defect	Result	Remarks
AUTOMATIC TEST:		
13 Brake System		الفرامل
13.04 - Brake Test	Passed	فحص الفرامل
14 Exhaust Gas Test		الغاز العادم والكربون
14.01 - Exhaust Gas Test	Passed	فحص الغاز العادم-الكربون
VISUAL TEST:		
02 Steering And Suspension System		عجلة القيادة ونظام التوصيلات
02.11 - Shock Absorbers		مخمد الصدمات
		SUSPENSION MALFUNCTION ( AIR BELLOW PUNCTURE & OUT OF HOLDER)
03 Brake System		نظام الفرامل
03.01 - Brake Efficiency Front Wheels Left And Right Hands		قوة فرامل المحور الامامي
		BRAKE PADS WORN OUT
04 Tires Rims		الاطارات والعجلات
04.01 - Front Left And Right Hands Tires		الاطارات الامامية
		ALL TYRES DOT 2018
04.07 - Rims		الرنجات
		SCRATCHES
05 Body		الهيكل
05.02 - Paint		الصنع
		BODY SCRATCHES & DENTS
05.08 - Chassis (Frame)		الشاصية
		FRONT LEFT SIDE MEMBER END DENT
06 General Items		الاشياء العامة
06.10 - Mirrors Side View		المرآيا الجانبية
		MALFUNCTION
06.12 - Seats Condition And Seats Fixing		المقاعد وحالتها وتثبيتها
		INTERIOR PARTLY WORN OUT
06.20 - Fuel Tank		خزان الوقود
		LOW FUEL ROADTEST NOT DONE
07 Remarks		ملاحظات
07.04 - Others		ملاحظات اخرى
		112240 KMS
09 Auction		الفحص الكامل
09.14 - Sign Of Front Accident		أثر حادث في مقدمة المركبة
09.24 - Digital Display Damaged/Warning Lights		عطل في لوحة التحكم الالكتروني
		RUN FLAT TYRE MESSAGE ON
09.25 - Body Repainted		أثر صنع في المركبة
		BODY PORTIONS REPAINTED


The Test Certificate Shows the test Result at the time of inspection only.

# Test Certificate



✓ PASS

Possession Certificate :	63838516		
Chassis No :	WDCBF7BE6BA755962		
Vehicle Make :	MERCEDES		
Vehicle Model :	GL450		
Vehicle Class :	Light Vehicle		
Body Type :	STATION		
Fuel :	Benzene		
Color :	Black		
Drive Direction :	--		
Dimensions : (H x W x L) -- x -- x --			
Current Odometer :	112243 Kms.		
Origin :	United States	Model Year :	2011
Gear Type :	--	Engine Size :	4700 CC
Engine No :	273923304...	Horse Power :	340
Axles No :	2	Cylinders :	8
No Of Doors :	4	No Of Seats :	7
G. V. W. :	3175 Kgs.	Empty Weight :	2585 Kgs.

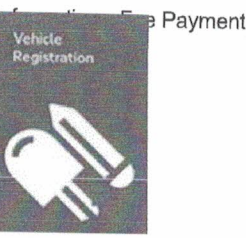

Certificate Number :	5-TAS-2019-11064101		
Inspection Date :	05-11-2019		
Certificate Print Date :	05-11-2019		
Services :	Registration Test		
Vehicle Testing Partner :	Tasjeel		
Vehicle Testing Center :	Tasjeel Al Aweer		
Total Time Taken :	13 min 56 sec		
Appointment Ref Number :	--		
Start Time :	18:28	End Time :	18:42
Lane :	02	Token No. :	143
Attempt :	1	Prints No. :	1

## Carbon footprint



Thank you! You are environment protector

## Estimated Vehicle Consumption (Rate last 12 Months)

5998 KM Distance per year	618 L Fuel consumed per year	1002 AED Fuel cost per year	1.5 ton Carbon footprint per year
------------------------------	---------------------------------	--------------------------------	--------------------------------------

## Parameter Readings

Service brake imbalance on front axle 15 %	Service brake imbalance on rear axle 1 %	Parking brake imbalance between LHS and RHS 2 %	Vehicle on Petrol CO Reading 0 %
Vehicle on Petrol HC Reading 0 PPM VOL			

Inspection Remarks: FRONT LEFT SIDE CHASSIS END MINOR DENT , MINOR SCRATCHES & DENTS

## Payment Details

Inspection Performed by 35820	Payment Method Cash	Transaction Number 11064101	Service Fees AED 170
Parking Slot No --	Service Name Registration Test	Attempt 1	Received by Manea Adel Manea Almathil

- This is to acknowledge the receipt of AED 170 (in words: One Hundred and Seventy Dirhams Only.), towards the above service.
- Information in this certificate regarding the annual consumption rate of the vehicle is based on estimated calculations.

هذه الشهادة صالحة لإجراء معاملة واحدة فقط خلال 30 يوم من تاريخ الفحص . المؤسسة غير مسؤولة عن العيوب الغير مرئية و الفحص الفني يتم ظاهريا طبقا لقانون السير و المرور 21 لسنة 1995  
This certificate is valid for one transaction only for 30 days from the date of inspection. Company not responsible for any hidden defects and inspection done-According to Traffic law No., 21 year 1995

