





Test Certificate

Site Number	: 840-EMIRATES AUCTION	Plate Code	: 0
Transaction Number	: 19980436	Plate Category	: PRIVATE
Transaction Date	: 16 JUN 2020 10:55:19	Plate Number	: 496 EA
Queue Number	: 186342	Import Doc. Ref.	:
Chassis Number	: JTHBF1D23E5008496	Manufacturer/Model	: LEXUS/IS 250
Engine Number	:	Model Year	: 2014
Vehicle Class	: LIGHT VEHICLE	Vehicle Color	: WHITE
Service / Indicator	: DSC AUCTION		

Statement of Vehicle Condition

Defect	Result	Remarks
AUTOMATIC TEST:		
13 Brake System		الفرامل
13.04 - Brake Test	Passed	فحص الفرامل
14 Exhaust Gas Test		الغاز العادم والكربون
14.01 - Exhaust Gas Test	Passed	فحص الغاز العادم-الكربون
VISUAL TEST:		
02 Steering And Suspension System		عجلة القيادة ونظام التوصيلات
02.15 - Suspension Crack Or Bend, Bushes		SUSPENSION BUSHES CRACK التوصيلات
03 Brake System		نظام الفرامل
03.01 - Brake Efficiency Front Wheels Left And Right Hands		BRAKE ROTORS RUSTY/ REAR BRAKE PADS WORN OUT قوة فرامل المحور الامامي
04 Tires Rims		الاطارات والعجلات
04.01 - Front Left And Right Hands Tires		FRONT TIRES DOT 2017 & 2018/ REAR TIRES DOT 2017 الاطارات الامامية
04.07 - Rims		SCRATCHES الرنجات
05 Body		الهيكل
05.02 - Paint		BODY SCRATCHES & DENTS الصنع
05.03 - Doors		BONNET REPLACED الابواب
05.08 - Chassis (Frame)		FRONT BOTH SIDE MEMBERS REPAIRED / DENTS الشاصية
05.09 - Front And Rear Windshields		FRONT WINDSHIELD REPLACED الزجاج الامامي والخلفي
05.12 - Side Safety Frame		BULKHEAD/ RADIATOR SUPPORT/ FENDER FRAME/ BUMPER SUPPORT REPAIRED الواقيات الجانبية
06 General Items		الاشياء العامة
06.11 - Seat Belts		REAR RIGHT SEAT BELT WEBBING CUT & SEWN/ LATCH MISSING حزام الامان
06.12 - Seats Condition And Seats Fixing		INTERIOR PARTLY WORN OUT المقاعد وحالتها وتثبيتها
06.14 - Transmission Condition		OK حالة ناقل الحركة
06.16 - Engine Condition, Smoke		OK حالة المحرك - الدخان
07 Remarks		ملاحظات
07.04 - Others		53346 MILES ملاحظات اخرى



Test Certificate

Site Number	: 840-EMIRATES AUCTION	Plate Code	: 0
Transaction Number	: 19980436	Plate Category	: PRIVATE
Transaction Date	: 16 JUN 2020 10:55:19	Plate Number	: 496 EA
Queue Number	: 186342	Import Doc. Ref.	:
Chassis Number	: JTHBF1D23E5008496	Manufacturer/Model	: LEXUS/IS 250
Engine Number	:	Model Year	: 2014
Vehicle Class	: LIGHT VEHICLE	Vehicle Color	: WHITE
Service / Indicator	: DSC AUCTION		

Statement of Vehicle Condition

09 Auction		الفحص الكامل
09.02 - Need Wheel Alignment		بحاجة الى ميزانية العجلات
09.14 - Sign Of Front Accident		أثر حادث في مقدمة المركبة
09.16 - Sign Of Side Accident		أثر حادث في جوانب المركبة
09.23 - Air Bag Damaged	BOTH SIDE CURTAIN AIRBAGS DEPLOYED & CUT	المخدة الهوائية لا تعمل
09.24 - Digital Display Damaged/Warning Lights	TPMS LIGHT ON	عطل في لوحة التحكم الالكتروني
09.25 - Body Repainted	BODY PORTIONS REPAINTED	أثر صنف في المركبة
The Test Certificate Shows the test Result at the time of inspection only.		

Test Certificate



PASS

Plate Details :	--
Chassis No :	JTHBF1D23E5008496
Vehicle Make :	LEXUS
Vehicle Model :	IS 250
Vehicle Class :	Light Vehicle
Body Type :	SALOON
Fuel :	Benzene
Color :	White
Drive Direction :	--
Dimensions : (H x W x L) -- x -- x --	
Current Odometer :	85856 Kms.
Origin : Japan	Model Year : 2014
Gear Type : --	
Engine No : NIL	Engine Size : 4600 CC
Axles No : 2	Horse Power : 204
No Of Doors : 4	
G. V. W. : 2268 Kgs.	Cylinders : 6
	No Of Seats : 5
	Empty Weight : 1570 Kgs.


Certificate Number :	5-TAS-2020-12062566
Inspection Date :	28-06-2020
Certificate Print Date :	28-06-2020
Services :	Registration Test
Vehicle Testing Partner :	Tasjeel
Vehicle Testing Center :	Tasjeel Al Aweer
Total Time Taken :	2 min 28 sec
Appointment Ref Number :	--
Start Time : 9:58	End Time : 10:00
Lane : 02	Token No. : 111
Attempt : 2	Prints No : 1

Carbon footprint



Thank you! You are environment protector

Estimated Vehicle Consumption (Rate in 12 Months)

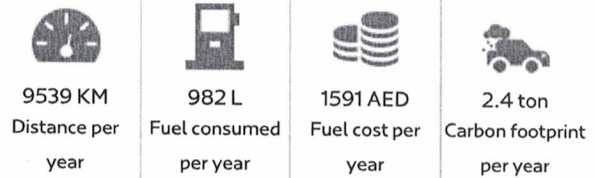

Inspection Findings

Discrepancies	Old Value	New Value	Verified
Engine Size Discrepancy in Engine Size	4600	2500	

Inspection Remarks:

FRONT BOTH SIDE FRAME MEMBER REPAIRED CCM OK W/O # 2020-06-27-14 BULKHEAD/ RADIATOR SUPPORT/ FENDER FRAME/ BUMPER SUPPORT REPAIRED

Payment Details

Inspection Performed by 35820	Payment Method Cash	Transaction Number 12062566	Service Fees AED 70 Collected on 28/06/2020
Parking Slot No --	Service Name Registration Test	Attempt 2	Received by Bajurdeen Abdul Gafoor

1 This is to acknowledge the receipt of AED 70 (in words: Seventy Dirhams Only), towards the above service.

2 Information in this certificate regarding the annual consumption rate of the vehicle is based on estimated calculations.

هذه الشهادة صالحة لإجراء معاملة واحدة فقط خلال 30 يوم من تاريخ الفحص . المؤسسة غير مسؤولة عن العيوب الغير مرئية و الفحص الفني يتم ظاهريا طبقا لقانون السير و المرور 21 لسنة 1995

This certificate is valid for one transaction only for 30 days from the date of inspection. Company not responsible for any hidden defects and inspection done-According to Traffic Law No., 21 year 1995

